

Report of Survey for Repairs, &c., of Engines & Boilers.

No. *4068*

(Received at London Office,

MONDAY 10 AUGUST 1885

No. in Survey held at

Reg. Book.

849 on the Machinery of the

Glasgow

Date, first Survey *July 30th*

Last Survey *August 1st 1885*

(Number of Visits *5*)
Year Month

Tonnage, Gross *2954*

Built at *Messrs Ramage & Ferguson, Leith*

When built *1882* 4

Ditto, Net *1930*

Owners *Hayzer Irvine & Co.*

Port belonging to *Glasgow*

Diameter of Cylinders *39 x 45*

Engines made by *D. Rowan Glasgow*

When made *1882*

Length of Stroke *48*

Boilers made by

When made *1882*

Pressure of Steam *85 lb*

If Surveyed Afloat or in Dry Dock *Govan dry dock*
(State Name of Dock.)

Classed *100A1 8-84*

Registered Horse Power *400*

Last Survey No.

Port

✠ L M B 8-84

Particulars of Repairs and Examination

Annual Survey

(State clearly the cause of Repairs if any, and in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage should be separated from Repairs due to other causes. State also the dates and initials of any letters respecting this case.)

Engines:- Cylinders, pistons, Slide Valves and pumps opened up and examined and found in good condition; propeller also examined. Sea cocks and valves overhauled. Crank shaft, pins, thrust and tunnel shafting carefully inspected. Low-pressure valve rod turned up and new brass bushes fitted.

Boilers:- Main and donkey boilers thoroughly examined internally and externally and found in good condition. New check valve and new safety valves for donkey boiler. The safety valves of main and donkey boilers tested under steam.

General Observations, Opinion, and Recommendation:--

(State clearly what alteration, if any, is suggested to be made in the existing notification of the vessel's machinery in the Register Book, consequent upon this survey.)

The Engines and Boilers of this vessel are now in good working condition and eligible in my opinion to be noted in the Register Book
✠ L M B 8-85

Office or Registration Fee (per Sec. 27) £ : :
Survey Fee (per Section 28) £ 2 : 2
Special Damage Fee (per Section 28) £ : :
*Certificate (if required) £ : :
Travelling Expenses (if chargeable) £ : :

received by me,
8/81 1885


L. Hindmarsh
Engineer Surveyor to Lloyd's Register of British and Foreign Shipping.

Committee's Minute

TUESDAY 11 AUGUST 1885

Assigned

L M B 85

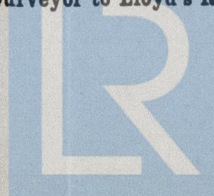

Lloyd's Register
Foundation

GLS150-0449

7068 92
It is submitted that this vessel is
eligible to have the notification
LMB 8.85 recorded.

DG
10/8/85



© 2019

Lloyd's Register
Foundation