

Report of Survey for Repairs, &c., of Engines & Boilers.

(Received at London Office, MONDAY 30 NOV 1885)

No. *4214*

No. in Survey held at *Glasgow*

Date, first Survey

Last Survey *20th Nov* 1885

Reg. Book.

1041 on the Machinery of the *T.S. Stratheden*

(Number of Visits *One*)

Tonnage, Gross *1462*

Built at *Dunbarton*

When built *1882-5*

Ditto, Net *934*

Owners *J. Hay & Sons*

Port belonging to *Glasgow*

Diameter of Cylinder *34 1/2*

Engines made by *Flaming & Ferguson*

When made *1882*

Length of Stroke *39"*

Boilers made by *Do*

When made *1882*

Pressure of Steam *80 lbs*

If Surveyed Afloat or in Dry Dock *Inglio Slip*
(State Name of Dock.)

Classed *100 A.1 4.85*

Registered Horse Power *200*

+ L.M.C. 7-82

Last Survey No.

Port

Particulars of Repairs and Examination

(State clearly the cause of Repairs if any, and in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage should be separated from Repairs due to other causes. State also the dates and initials of any letters respecting this case.)

When this vessel was on slipway the sea connections &c were all examined - Point of one propeller blade broken - Main boiler opened out for survey & examined over all parts - Leakages in combustion chambers have been attended to - One furnace plate laminated in two plates - in one of these the defective part has been cut out & a patch plate riveted on -

General Observations, Opinion, and Recommendation :--

(State clearly what alteration, if any, is suggested to be made in the existing notation of the vessel's machinery in the Register Book, consequent upon this survey.)

*The main boiler of this vessel is in good & safe working condition and it is submitted that the notation **B.S. 11-85** be made in the Register Book.*

Office or Registration Fee (per Sec. 27) £ : :
 Survey Fee (per Section 28) £ *2 2* -
 Special Damage Fee (per Section 28) £ : :
 *Certificate (if required) £ : :
 Travelling Expenses (if chargeable) £ : :

received by me, *[Signature]*
28/11/85 1885


Walter Robson
 Engineer Surveyor to Lloyd's Register of British and Foreign Shipping.

Committee's Minute

TUESDAY 1 DEC 1885

Assigned

B.S. 11, 85

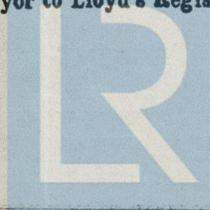

Lloyd's Register Foundation

GLS151 - 0197

Report to also sent on the Machinery...
 The Surveyors are requested not to write on or below the space for Committee's Minute.
 * Certificate to be sent to...
 Transfer Ink...
 4000-2/2/84-

Insert Character of Ship and Machinery precisely as in the Register Book.

7214 gls

It is submitted that this vessel
is eligible to have the notification
B.S. 11.55 recorded.

D.P.

30/11/85



© 2019

Lloyd's Register
Foundation

PLEASE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.