

s/s 'Plantio'


State Report No 740#5

HUL 403 - 0002



© 2019

Lloyd's Register
Foundation

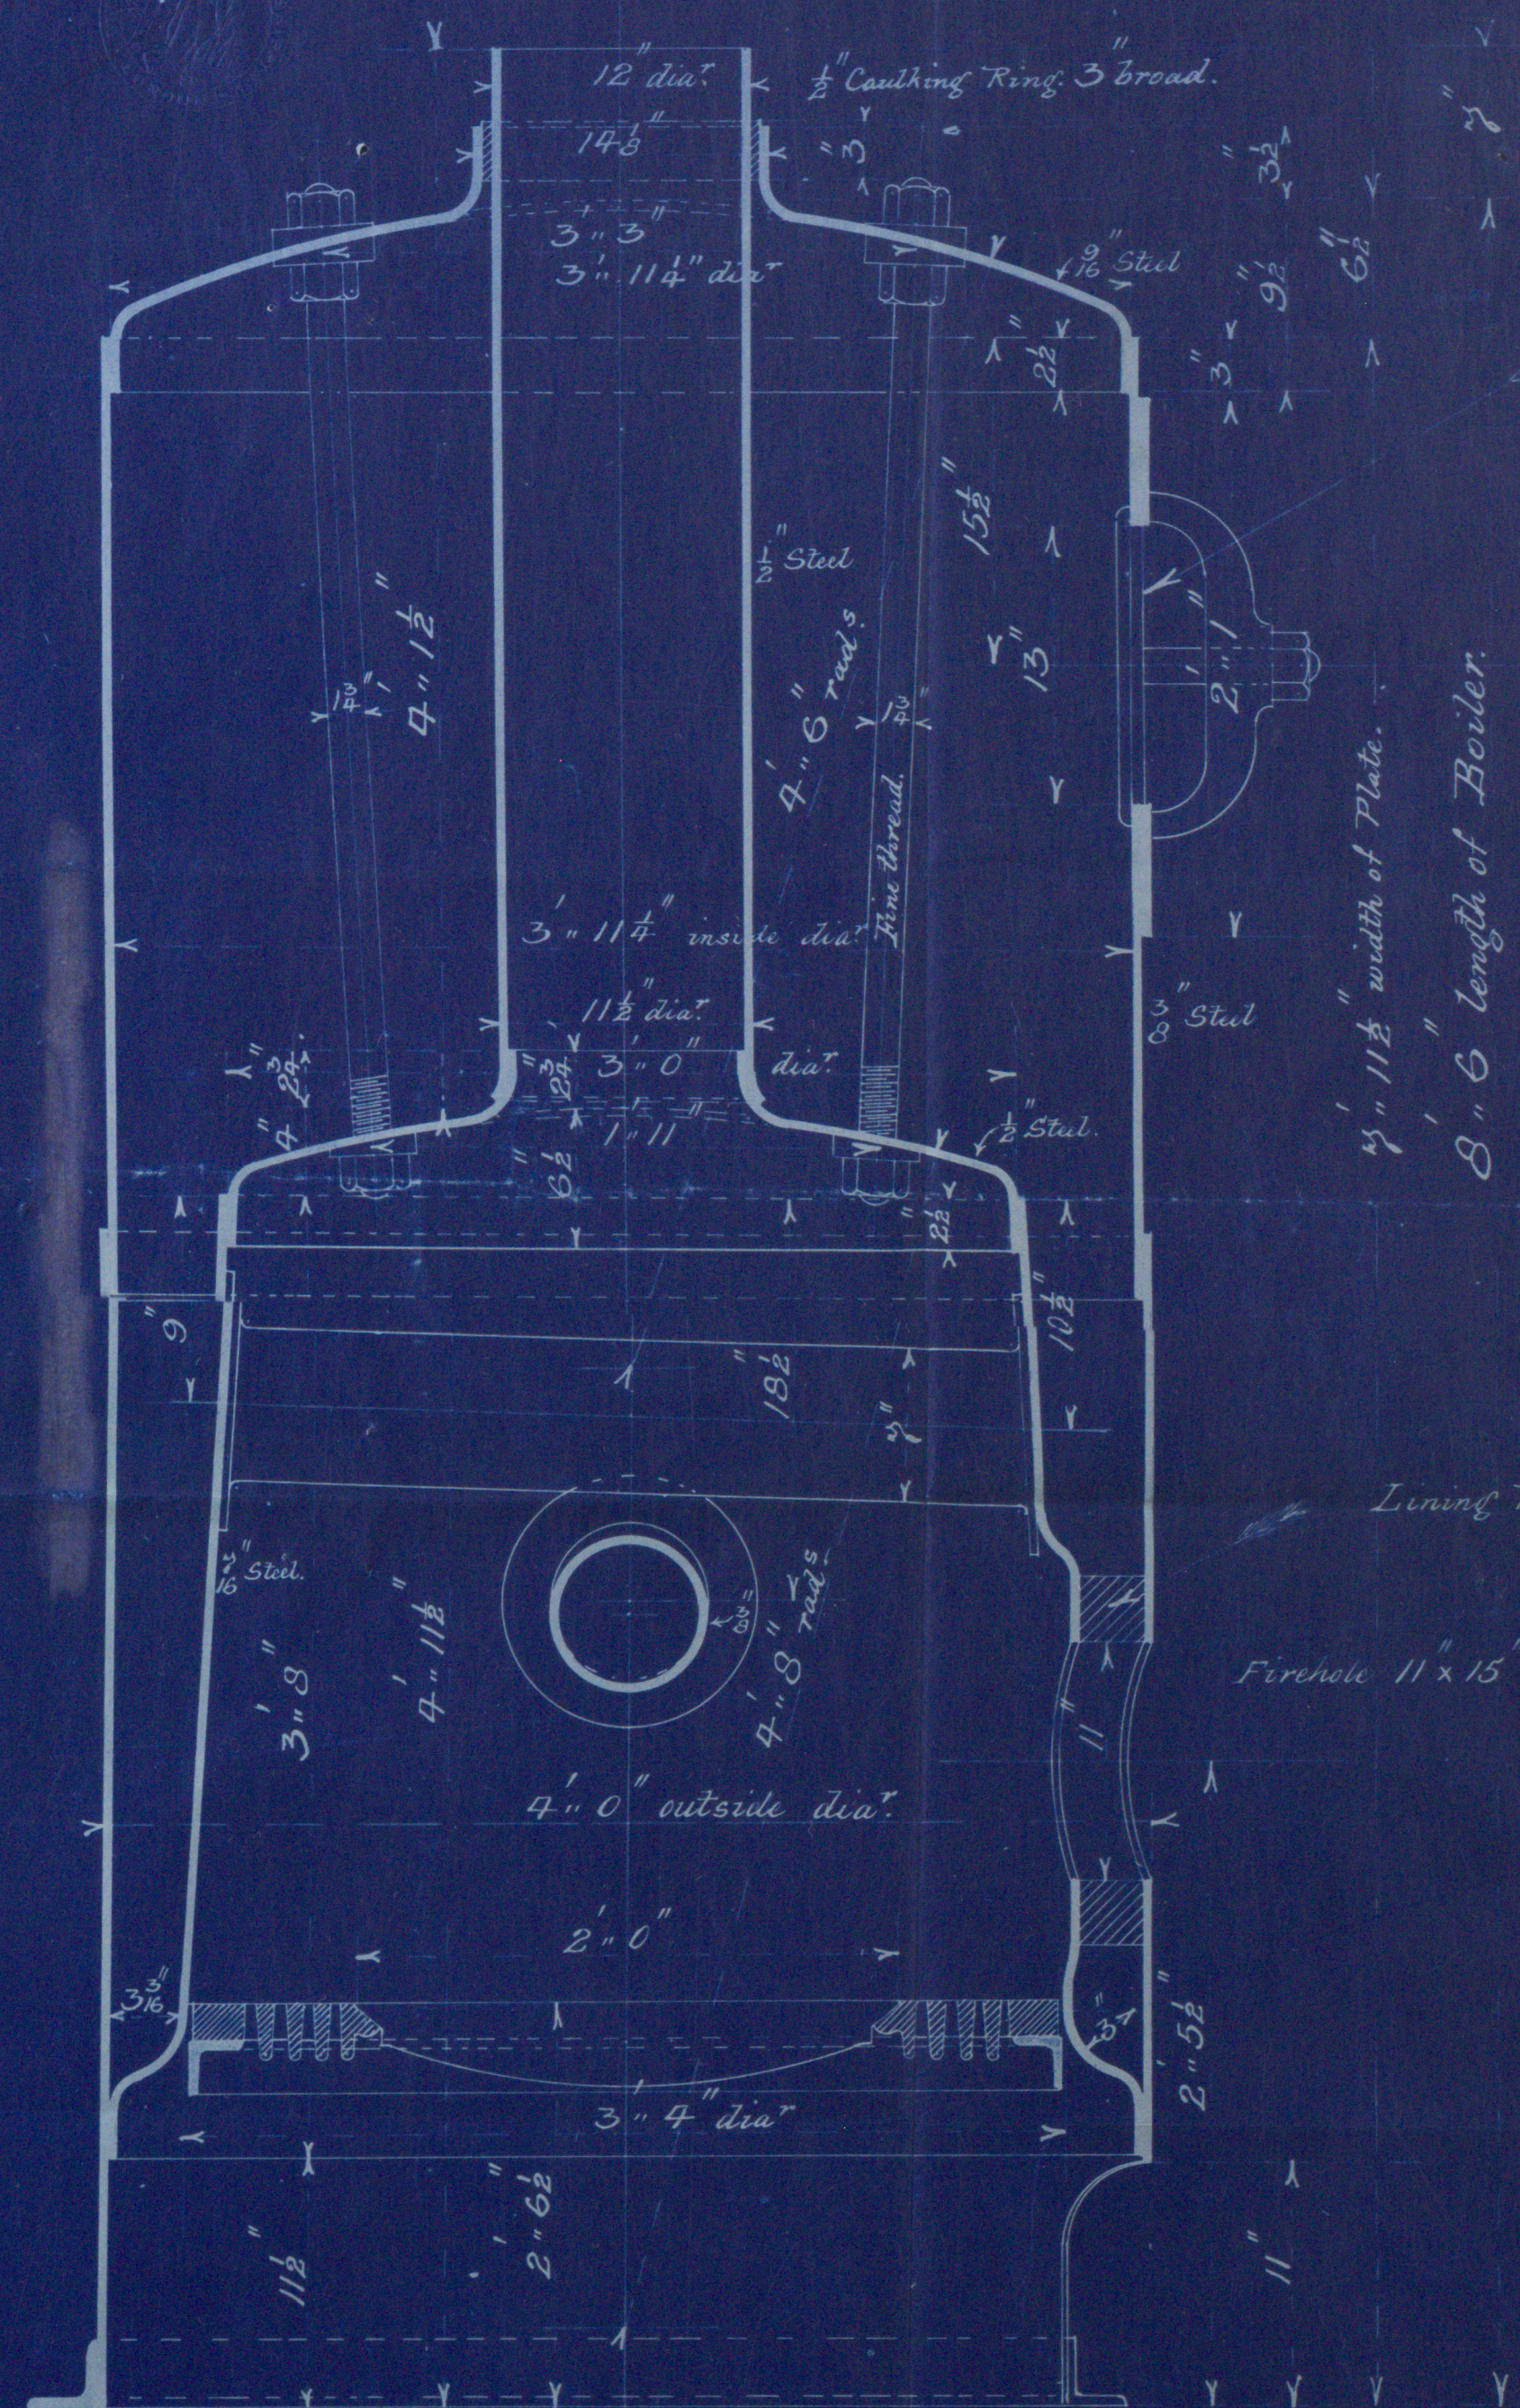

Particulars of Rivetting
 Longitudinal seams to be double riveted lap
 1/2" Holes 3" pitch.
 Circumferential seams to be single riveted lap
 1/2" Holes 2" pitch.

Manhole 16 x 13
 lined outside with
 1/2" plate 6" broad

1/2" 11 1/2" width of Plate.
 8" 6" length of Boiler.


Lining Ring 3" x 3"

Firehole 11 x 15"



WORKING PRESSURE 80 lbs
 AREA OF FIRE GRATE 8.5 sq ft
 DIAM. OF SAFETY VALVE 3"

Stays 1 1/4" dia. (11 effective)
 made of Iron, screwed into
 the top of firebox and filled
 with nut and washer inside.

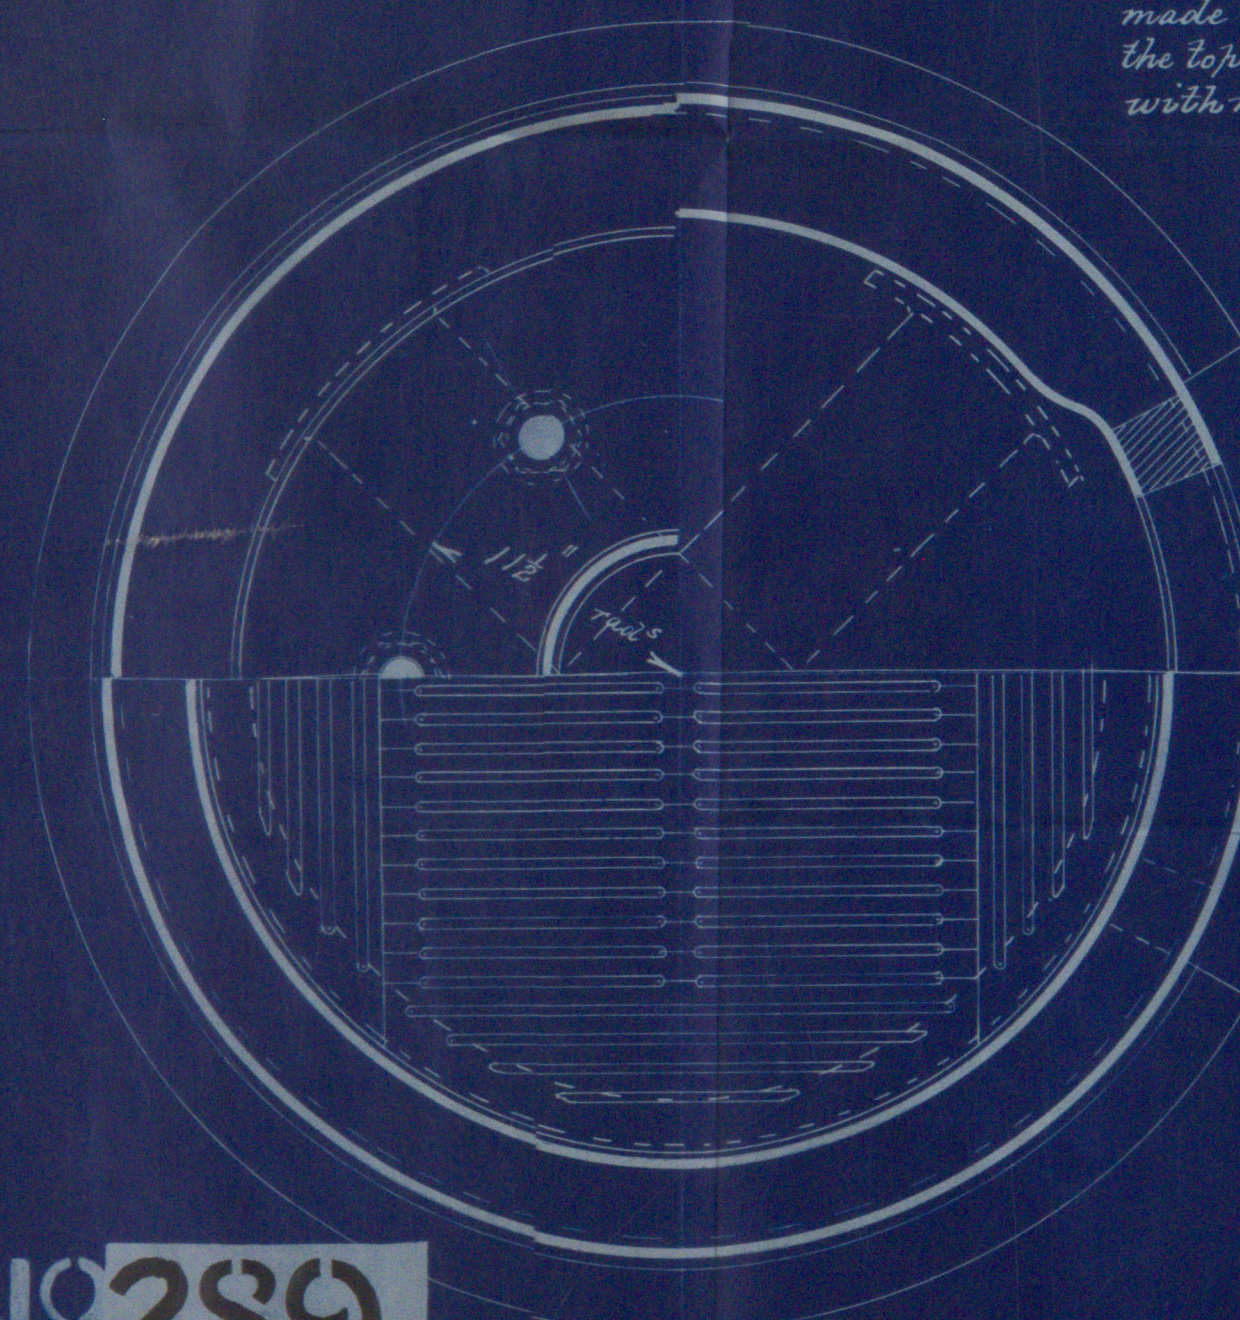

DONKEY BOILER No 289

SCALE 1/2" INCH TO A FOOT

CHARLES D. HOLMES & CO.
 ENGINEERS & BOILER MAKERS
 HULL 16/5/87

