

REPORT of SURVEY for REPAIRS.

No. in Reg. Book. **No. 2636** Survey held at Wesh Hartlepool Date 31 Jan. to 10 Feb 1868
 21 on the Screw Steamer "Damietta" Master H. Davies
 Tonnage 565 Built at Middlesbro When built 1864
 By whom built Backhouse Owners Atkinson & Co
 Port belonging to Middlesbro Destined Voyage _____
 If Surveyed Afloat or in Dry Dock In the Harbour Dock

Last Survey, No. 5549 Port Iron. Classed B 1 SD 101 67

REPAIRS now done, Seven shell plates on the Port side taken down at stem & three do. on the S. side. Bent stem heated & set fair, eight of the plates reset & refitted, two do. renewed, Rivets in stem to the extent of twelve feet renewed, one small breasthook fitted inside, one shell plate at Port bulge taken out & renewed, several started bulges in bottom caulked up, cement in bilge in way of new plate made good, bedding relined, Bottom coated with two coats of black barnish & paint.

Present Condition of the

Decks	Transoms	Windlass and Capstan
Waterways	Rivets	Pumps
Comings	Breasthooks and Stemson	Boats
Upper Deck Beams & Fastenings	Transoms, Pointers, and Crutches	Masts, Yards, &c.
Lower Deck Beams & Fastenings	Timbers of the Frame at the openings	Condition, how ascertained
Planksheers	Ditto Ditto at other places	Sails
Sheerstrakes	Keelsons	Anchors No. of
Topsides	Clamps and Shelves	Cables
Wales	Ceiling	Hawsers and Warps
Plating (Bottom) and Counter	Rudder	Standing & Running Rigging
	Copper	
	When put on	

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. Good

Is now in a good & efficient state, fit for the safe conveyance of dry & perishable goods to & from all parts of the world & may in my opinion remain so now classed B 1


The Amount of Fee.....£ 2 : 0 : 0 is received by me,

Damage Survey Special..... 5 : 5 : 0
 Certificate (if required) : :

Committee's Minute 14th February 1868

Character assigned B 1

record damage repairs was

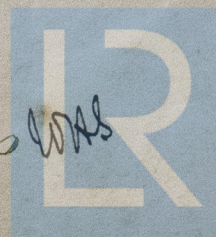

© 2019

Lloyd's Register Foundation

IRON441-0469