

Report of Survey for Repairs of Engines and Boilers.

No. 12

No. in Reg. Book. Survey held at

Hull

Date, first Survey 16 of June Last Survey 14 of Nov 1876

58 on the Iron screw Steamer Vine

Tons 460

Owners E. Leetham Port belonging to

Hull

Classed

Years assigned.

Character in Register Book.

A1

Diameter of Cylinder 4 : 18" x 30"

Length of Stroke 26"

Engines made at

Hull

When made 1866

Pressure of Steam 62 lbs

Nominal Horse Power 60

By whom made

Ch & W Earle

Particulars of Repairs and Examination

Engines: Compounded by fitting two high pressure cylinders on the top of the low pressure cylinders. - Valve spindles & piston rods returned. New brass buckets for circulating and air pumps. - All glands are rebushed & new collar bushes provided. - All working parts are adjusted and overhauled. - New boiler made & fixed in Vessel in accordance with Society's Rules. - In my opinion the vessel is now entitled to be marked Lloyd's, M C, in the Register Book.


The Amount of Fee ... £ 3 : 3 : - received by me, w.e.s.
Certificate (if required) ... £ - : - : - (24 Dec 1876)

(Travelling Expenses, if any, £ - : - : -)

Committee's Minute

18

Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

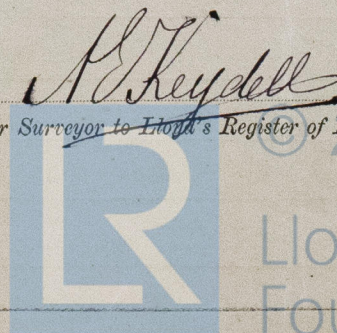

Lloyd's Register Foundation

IRON469-0333