

24409

# Report of Survey for Repairs of Engines and Boilers.

To. *X*  
No. in Reg. Book. *308* Survey held at *London* Date, first Survey *May 6<sup>th</sup>* Last Survey *Sept 15<sup>th</sup>* 18 *79*

Built at *London* When built *1853*

Owners *J. Watkins* Port belonging to *London* Classified *80 A 1* Character in Register Book. *Lloyd's MC 479*


ter of Cylinder *31+* Engines made at *Port Glasgow* When made *1870*  
of Stroke *30* By whom made *Blackwood & Gordon* *NB 69*  
re of Steam *30lb*  
ered Horse Power *80*

Particulars of Repairs and Examination *Engines taken out and the*  
*engines ex S.S. "Pandora" fitted. New screw shaft*  
*fitted. Superheater taken off Boilers, and a*  
*new funnel fitted. Boilers examined and the*  
*rust plates at bottom of back water spaces*  
*renewed. A new Donkey Boiler fitted in*  
*stoke hold, working pressure 50lb per sq inch.*  
*The machinery of this vessel is now in good order*  
*and safe working condition and in my opinion*  
*enders her eligible to have a new machinery*  
*certificate granted and the record Lloyd's MC 479*  
*recorded in the Register Book, but the Boilers*  
*should, in my opinion be resurveyed at the*  
*expiration of 12 months from this date, also to*  
*be marked N.E. 70.*

To be recorded in Register Book  
*I. 2cy 34-30 30lb. 80HP.*  
*N.E. 70, NB 69, Lloyd's MC 479.*  
*Blackwood & Gordon Port Glasgow*

Amount of Fee ... *18/9/79* £ *5 : 5 : 0* received by me, *J. I. Milton*  
Certificate (if required) ... £ *2 : 6 : 0* 1879  
Expenses, if any, £

Committee's Minute  
*18*  
*1869.79*  
*with him it*

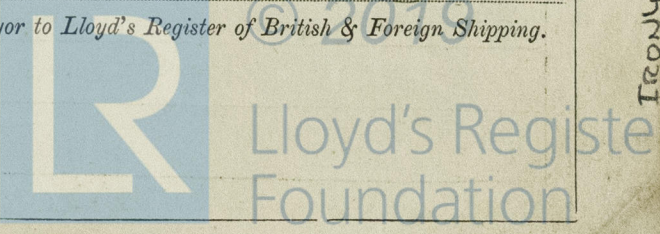

180487-0292



The old engines in this vessel  
have been taken out and the engines  
of the S.P. Pandora fitted, the  
Boilers have also been repaired  
but are now 10 years old.  
Submitted that she is  
eligible to have Lloyd's  
M.C. and a machinery  
certificate 9.79 subject  
to the Boilers being  
examined in  
12 months from  
this date 1907  
22.9.79



© 2019

Lloyd's Register  
Foundation