

28429

Report of Survey for Repairs of Engines and Boilers.

No. 402

(Received at London Office, 27/11/80)

No. in Reg. Book.	Survey held at	Newcastle	Date, first Survey	21 st Sept	Last Survey	27 th Oct	1880
1123	on the Machinery of the	Screw Steamer "Anago"	(Number of Visits	10	Year		
Tonnage, Gross	1615	Built at	Newcastle	When built	1876	Year	
Ditto, Net	1061	Owners	Gills & Co.	Port belonging to	Liverpool	Year	
Diameter of Cylinder	26 1/2"	Engines made by	R. Stephenson & Co.	When made	1876	Year	
Length of Stroke	42"	Boilers made by	Do - - - Do -	When made	1876	Year	
Pressure of Steam	80 lbs.	If Surveyed Afloat or in Dry Dock	Afloat in dry dock	Classed	100 A 1	Years assigned.	12-49
Registered Horse Power	170	Port		Legals M.C. 4.46			
Last Survey No.							

Particulars of Repairs and Examination of engines and boilers in accordance with the requirements of the Rules for Special Survey No. 1 for Iron Ships and in consequence of damage said to have been sustained by the Vessel grounding and the propeller slipping off in Adm Harbour.

Vessel placed in Messrs. A. Leslie & Co's dry dock; all covers and valves on outside plating overhauled, New propeller and propeller shaft fitted and the propeller secured on shaft with nut instead of with cotter as formerly. Bearings, slide valves and all pumps and pipe connections overhauled, Crank shaft examined and found good.

Main boilers retubed and furnaces patched at strengthening rings; portions of bottom of boiler ^{shell} renewed & alked. Safety valves examined and set to a working pressure of 80 pounds per square inch.


Donkey boiler retubed and back tube plate repaired; safety valve overhauled and weights checked to a working pressure of 65 lbs. per square inch.

General Observations, Opinion, and Recommendation:— The machinery of this vessel is now in good order and safe working condition and eligible in my opinion to retain her class in the Society's Register Book

Entry or Registering Fee ... £ 1 : 10 : -
Survey Fee ... £ 3 : 3 : - received by me, *W.H.S.*
Certificate (if required) ... £ - : - : - 26th Nov 1880
Travelling Expenses, if any, £ -

David James.
Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.
North Shields

Committee's Minute 188
Assigned

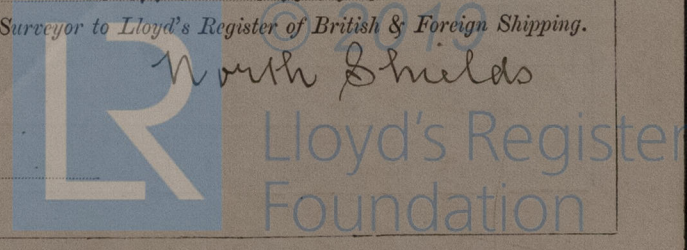

It is submitted that this
vessel is eligible to have
the notification
Lloyds Reg. No. 10.80
Recorded in the
Register Book
Jm
29/4/60



© 2019

Lloyd's Register
Foundation