

28838

Report of Survey for Repairs of Engines and Boilers.

5248
 Survey held at Glasgow Date, first Survey Dec 4th Last Survey Dec 4th 1880
 (Received at London Office, 16/12/80)
 on the Machinery of the S.S. Renfrewshire (Number of Visits One)
 Tonnage, Gross 818 Built at Port Glasgow When built 1840-6ms
 Tonnage, Net 506 Owners H. L. Schimann & Son Port belonging to Glasgow
 Diameter of Cylinder 26" x 44" Engines made by Blackwood & Gordon When made 1840-6ms
 Length of Stroke 30" Boilers made by " " " When made 1840-6ms
 Pressure of Steam reduced to 50 lbs If Surveyed Afloat or in Dry Dock Afloat Years assigned 7 Character in Register Book A 1
 Registered Horse Power 90 Classed 1.80
 Last Survey No. 25588 Port Iron B & M.S. 1.80

Particulars of Repairs and Examination Engines, opened up and working parts examined. Crank shaft journals examined, pumps pipes & connections examined.

Main Boilers, examined found the shell plating opposite Combustion chambers, somewhat corroded also stays in Steam space, otherwise it is in fair condition
Donkey Boiler, repaired by fitting new uptake

General Observations, Opinion, and Recommendation:—In consequence of the condition of the main boiler, the pressure has now been reduced from 60 lbs to 50 lbs per inch, and in my opinion it should be again examined by one of the Society's Surveyors in six months and noted in the Register Book as recommended this boiler to be extensively repaired or renewed at the expiration of that time


Entry or Registering Fee ... £ " : " :
 Survey Fee ... £ 2 : 2 : received by me, Dec 15th
 Certificate (if required) ... £ " : " : Dec 1880
 (Travelling Expenses, if any, £ ✓)

James Morrison
 Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute Friday, December 17th. 1880.
 Assigned B & M.S. 12.80
with limit of 6 months
Ltr to owners 18/12/80
Sent to Mpl 13/1/81

The Surveyors are requested not to write on or below the space for Committee's Minute.

TRENCHARD-0448

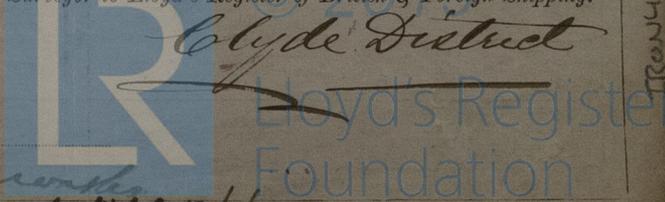

It is submitted that this
need is likely to have
the notification B.M.
1250 records in the
Register Book
subject to the
books being again
seen in the books

AM DTB

16/1/68

