

REPORT of SURVEY for REPAIRS.

No. 21 Survey held at London Date 18th 30th Jan'y 1854
 on the Ship "Rajah of Sarawak" Master Jiles
 Tonnage 525 Built at Bideford When built 1850
 By whom built _____ Owners Jenkins
 Port belonging to Swansea Destined Voyage _____
 If Surveyed Afloat or in Dry Dock Line Vilm dry Dock

Last Survey, No. 017 Port Bideford Classed 13 A1

REPAIRS At the present time under special survey for damage Particulars in Special Report. New fore piece of Main Keel 41 feet long of 8 Elm two planks in Starboard bidge 30 feet and thirty seven feet lengths of Canada Rock Elm and four planks of bottom 30 feet 26 feet and twelve feet Canada Elm, And on the larboard side fore head of Garboard strake 54 feet long English Elm and one fore head of bottom 9 feet long 8 Elm, And two planks of bottom of English Elm 21 feet and 17 feet lengths. The Yellow Metal stripped off the Bottom Ship hung in Shores and Caulked from Keel to Wale and the bottom Resheathed with Yellow Metal over dry paper.

The following Repairs not for Damage, in grounding but from having been badly Wormed, now Renewed with Oak and Green Oak one strake of Wale in Midships on each side. And three after heads of Wale on each side and the other planks of Wale where slightly wormed made good by puccing.

Present Condition of the

Decks <u>Good</u>	Treenails	Windlass and Capstan
Waterways <u>Do</u>	Breasthooks and Stemson	Pumps
Comings <u>Do</u>	Transoms, Pointers, and Crutches	Boats
Upper Deck Beams & Fastenings <u>Good</u>	Timbers of the Frame	Masts, Yards, &c.
Lower Deck Beams & Fastenings	Keelsons <u>Good where</u>	Sails <u>Good & Hoft</u>
Plank sheers <u>Do</u>	Clamps and Shelves <u>Seen</u>	Anchors No. of <u>3 B 15 15</u>
Sheerstrakes <u>Do</u>	Ceiling	Cables
Topsides <u>Do</u>	Rudder	Hawsers and Warps
Wales <u>Do</u>	Copper <u>Y Metal</u> When put on <u>New New</u>	Standing & Running Rigging
Plank (Bottom) and Counter		

General Observations and Opinion,

This ship is now in good Condition and eligible to remain as classed

The Amount of Fee.....£ 3 : — : — is received by me,

Special..... 3 : 3 : —

Certificate (if required) : : —


Committee's Minute

Character assigned

7th Feb'y 1854

13 A1

M. M. Intyre
B. W. W. W.

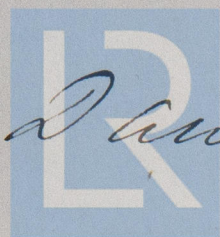

© 2019

Lloyd's Register
 Foundation

201634-0173