

REPORT of SURVEY for REPAIRS.

18795

No. 100 Survey held at London Date 16th Feb 1854 1854
 on the Barge, "Persian" Master _____
 Tonnage 302 Built at Sunderland When built 1840
 By whom built _____ Owners J. Steel
 Port belonging to Jorquay Destined Voyage Honduras
 If Surveyed Afloat or in Dry Dock Dowson's dry Dock

Last Survey, No. 546 Port Penrynouth Classed 9 8853 *F. 1
 C 3 3

REPAIRS

On the 16th February a notice card was sent to the Owner recommending, the defective plank in Buttocks, Wales, Topsides, Planksheers, and the badly decayed spirtetting on hold beams to be removed and renewed. The yellow metal sheathing on bottom being much wrinkled and broken and the caulking of Bottom Stacks which also requires caulking before she could be recommended to the Committee for Classification. The repairs which have been done are as follows.

On the Starboard side renewed with American Oak three planks of Topsides two planks of Blackstrakes one Fore head of Wales, two planks of Buttocks. And on the Starboard side one Fore head of Wales, and two planks of Buttocks and one plank of Blackstrake.

The Owner has stated that he intends lengthening this vessel after making this voyage and does not intend doing the repairs required to keep up her present condition of the present class.

Decks	Treenails	Windlass and Capstan
Waterways	Breasthooks and Stemson	Pumps
Comings	Transoms, Pointers, and Crutches	Boats
Upper Deck Beams & Fastenings	Timbers of the Frame	Masts, Yards, &c.
Lower Deck Beams & Fastenings	Keelsons	Sails
Planksheers	Clamps and Shelves	Anchors No. of
Sheerstrakes	Ceiling	Cables
Topsides	Rudder	Hawsers and Warps
Wales	Copper When put on	Standing & Running Rigging
Plank (Bottom) and Counter		

General Observations and Opinion, The whole of the defective planking and Planksheers not being removed, also the defective spirtetting, and the Bottom not having been caulked, we are of opinion she is unfit for her present class.

The Amount of Fee £ : : is received by me,

Special : :


Certificate (if required) : :

Committee's Minute 24 Feb 1854

Character assigned Spring Character

M. M. Intype

J. S. Martin

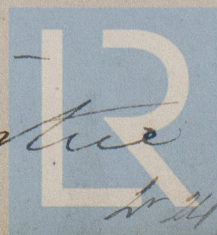

© 2019

Lloyd's Register
Foundation

104634-0214