

REPORT of SURVEY for REPAIRS.

18977

No. 364 Survey held at London Date Mar 29th to Apr 8th 18 54
 on the Bark "John Edward" Master not appointed
 Tonnage 323 Built at Sunderland When built 1844
 By whom built _____ Owners J. C. Munro
 Port belonging to London Destined Voyage not fixed
 If Surveyed Afloat or in Dry Dock Fore and Aft dry dock

last Survey, No. 17002 Port London Classed 12 A. 1.

REPAIRS
 Now done, Keelson renewed from forward to about five feet abaft the main mast, with Teak ^{ins} sided by ^{ins} 14 moulded, bolted with ^{ins} 1 1/2 Yellow Metal bolts; Midships shifts of Topside plank on both sides of ship renewed with Teak and English Oak; Three fore hoods of upper course of bottom shifted and renewed with English Oak, on account of worm, also four after hoods on ^{ins} L^{ts} side and four buttock plank on Starboard side; Yellow Metal sheathing stripped off the bottom, bottom caulked to plank sheers, and is sheathed with Yellow Metal on Felt upper course, and paper below —

Present Condition of the			
Decks	<u>Caulked</u>	<u>Good</u>	Treenails
Waterways	<u>"</u>	<u>"</u>	Breasthooks and Stemson
Omings	<u>"</u>	<u>"</u>	Transoms, Pointers, and Crutches
Upper Deck Beams & Fastenings	<u>all good</u>		Timbers of the Frame
Lower Deck Beams & Fastenings	<u>where seen</u>		Keelsons <u>part new</u>
Plank sheers	<u>"</u>		Clamps and Shelves
Sheerstrakes	<u>"</u>		Ceiling
Topsides <u>part new</u>	<u>Caulked</u>	<u>"</u>	Rudder
Wales	<u>"</u>		<u>Yellow Metal on upper course Felted</u>
Plank (Bottom) and Counter	<u>"</u>		<u>Copper paper & Felt When put on how new</u>
			Windlass and Capstan <u>which good</u>
			Pumps <u>"</u>
			Boats <u>3 in no good</u>
			Masts, Yards, &c. <u>good & sufft</u>
			Sails <u>2 1/2 suits good</u>
			Anchors No. of <u>3 B. 1 S. 1 K</u>
			Cables <u>good & sufft</u>
			Hawsers and Warps <u>sufft & good</u>
			Standing & Running Rigging <u>"</u>

General Observations and Opinion, The ship now appears in good condition, and eligible to remain classed A. 1. B. Maymouth


The Amount of Fee.....£ 2 : — : — is received by me, AS

Special.....: : :

Certificate (if required).....: : :

Committee's Minute 5 May 1854

Character assigned 12 A. 1.
record repairs

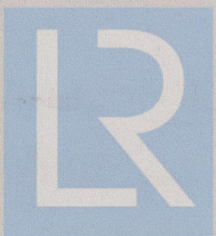

© 2019
 Lloyd's Register
 Foundation

101634-0396