

REPORT of SURVEY for REPAIRS.

No. 534 Survey held at London Date 24th July 1859
 on the Ship "Anglo Saxon" Master J. Laird
 Tonnage 926 Built at Sunderland When built 1854
 By whom built _____ Owners W. & F. Frost
 Port belonging to London Destined Voyage London & China
 If Surveyed Afloat or in Dry Dock Afloat: London Docks

Last Survey, No. 21096 Port London Classed 13A1

REPAIRS

The strake next the waterways removed and replaced with a thick strake of Oak set down into the beams. The original waterways doubled with Oak and made flush with the top of the Planksheer & dovetailed to the original waterway the new work being fastened in & out with yellow metal bolts & up & down through beams, shelf &c with Iron. The latter being noted to the owner by us as objectionable to her present class.

The upper shifts in Poop & Forecastle drifts outside & the same inside removed and replaced with oak planks extending beyond several stentions before & abaft the breakers of the Poop & Forecastle and bolted thereto.

Present Condition of the

Decks <u>Good</u>	Treenails <u>Good where seen</u>	Windlass and Capstan <u>Good</u>
Waterways <u>Doubled over</u>	Breasthooks and Stemson <u>"</u>	Pumps <u>"</u>
Comings <u>Good</u>	Transoms, Pointers, and Crutches <u>"</u>	Boats <u>"</u>
Upper Deck Beams & Fastenings <u>"</u>	Timbers of the Frame <u>"</u>	Masts, Yards, &c. <u>New Fore Mast</u>
Lower Deck Beams & Fastenings <u>"</u>	Keelsons <u>"</u>	Sails <u>2 suits</u>
Planksheers <u>"</u>	Clamps and Shelves <u>"</u>	Anchors No. of <u>3 13-15 16</u>
Sheerstrakes <u>"</u>	Ceiling <u>"</u>	Cables <u>Sufficient</u>
Topsides <u>"</u>	Rudder <u>"</u>	Hawsers and Warps <u>"</u>
Wales <u>"</u>	Copper <u>When put on 1857</u>	Standing & Running Rigging <u>"</u>
Plank (Bottom) and Counter <u>Good where seen</u>		

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. Good where seen

The Committee having permitted the iron fastenings above named to remain we are of opinion that this ship is in good and efficient condition, eligible to remain as classed


The Amount of Fee.....£ : : is received by me,

Special..... 2 : 2 : - 25/5/59

Certificate (if required) : :

Committee's Minute 27th May 1859

Character assigned 13A1

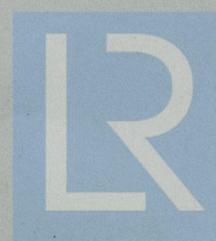

© 2019

Lloyd's Register Foundation

LDNG041-0130