

226115

REPORT of SURVEY for REPAIRS.

No. 270 Survey held at London Date May 3rd to 21st July 1859
 on the Barque "Maria Somes" Master
 Tonnage 600 Built at Garmouth When built 1841
 By whom built 786 Owners Messrs Somes, Bro'
 Port belonging to London Destined Voyage
 If Surveyed Afloat or in Dry Dock Canal Dry Dock & West India Dock

Last Survey, No. 21417 Port London Classed Rest-52 - S.A. 1.

REPAIRS

Now done, the Yellow Metal sheathing stripped off the bottom, the knee of stem and all attached taken down, refitted and bolted, one 4" awl pipe renewed, the other refitted, a middle piece of stem and upper piece of Apron renewed with English Oak & Teak; several planks of ceiling in the run and in midships both sides, renewed; four Cant timbers each side aft and the Heel knee renewed with English Oak; the midship piece of Kulson and the after piece, also the Hog Kulson from the Fore Mast-step aft, renewed with Teak; five after hoods of bottom plank on the starboard, and three on the L^d side new; one fore hood of wale on the starboard bow renewed with English Oak, and one plank on the L^d side in midships with Teak; False Bul taken down and replaced in way of the new Kulson bolts; the keel strengthened extending from the lower edge of the wale to the lower part of the bilge in midships and down to the Bul fore and aft; the upper and lower deck bows renewed with English Oak and one new of Iron in the tween decks on Teak & Kings - A pair of Riggers new forward; three Crutches refitted and one added across the Kulson; Present Condition of the Ship being in Shores and Caulked from the upper edge of wale to the Bul

Decks	Treenails <u>greater part new</u>	Windlass and Capstan
Waterways } <u>Good where seen</u>	Breasthooks and Stemson <u>part new</u>	Pumps
Comings }	Transoms, Pointers, and Crutches <u>refitted</u>	Boats
Upper Deck Beams & Fastenings } <u>firm</u>	Timbers of the Frame <u>good where seen</u>	Masts, Yards, &c. } <u>Good and</u>
Lower Deck Beams & Fastenings }	Keelsons <u>part new</u>	Sails } <u>Suff^y</u>
Planksheers } <u>Good where</u>	Clamps and Shelves <u>good where seen</u>	Anchors No. of }
Sheerstrakes } <u>seen</u>	Ceiling <u>part new</u>	Cables
Topsides }	Rudder <u>good</u>	Hawsers and Warps
Wales <u>Caulked & strengthened</u>	Yellow Metal <u>good</u>	Standing & Running Rigging
Plank (Bottom) and Counter <u>Caulked</u>	Copper on Tell. } When put on <u>new</u>	

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. Good where seen and tested.

She is now fit in my opinion to remain as classed Rest-52 - S.A. 1.

W. W. W. W. W.


The Amount of Fee.....£ 2 : - : - is received by me,

Special..... 2 : 2 : -

Certificate (if required) : : -

Committee's Minute 26th August 1859

Character assigned Rest 52 - S.A. 1

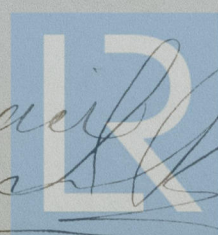

© 2019

Lloyd's Register Foundation

LOU641-0275