

24431

REPORT of SURVEY for REPAIRS.

No. 57 Survey held at London Date 6th to 14th Jan'y 1862
of the B^k Harley Bird Master R Selby
Tonnage 349 Built at Littlehampton When built 1852
By whom built _____ Owners J^d Shepherd
Port belonging to London Destined Voyage for West Indies
If Surveyed Afloat or in Dry Dock Union Dry Dock

Last Survey, No. 23333 Port London Classed 13A1
6-60.

REPAIRS

New fore-castle drifts of oak and general timbers
rove down thro' the plank-sheer, in the fore-castle, two bolts
in the breast-hooks, below the hold beams, removed next the
throat, an extra beam fitted midway between the
hold beams and keelson close to and bolted thro' the plank
bites, bolted thro' the ends with Y bar and further secured
with a pair of wood knees, also a thwartship chock, close forward
the head knee & fittings taken down and refitted the bowsprit
having been lifted and the house pipes refitted.
The vessel caulked from metal line to beam and waterways

Present Condition of the

| | | | | | |
|-------------------------------|------------------------|----------------------------------|---|----------------------------|---------------------|
| Decks | <u>Good</u> | Treenails | <u>Good where seen</u> | Windlass and Capstan | <u>Good</u> |
| Waterways | " | Breasthooks and Stemson | " | Pumps | " |
| Comings | " | Transoms, Pointers, and Crutches | " | Boats | <u>Good</u> |
| Upper Deck Beams & Fastenings | " | Timbers of the Frame | " | Masts, Yards, &c. | " |
| Lower Deck Beams & Fastenings | " | Keelsons | " | Sails | <u>Insufficient</u> |
| Plank-sheers | " | Clamps and Shelves | " | Anchors No. of | " |
| Sheerstrakes | " | Ceiling | " | Cables | <u>Good</u> |
| Topsides | " | Rudder | <u>Repaired & renewed at the Cape of 3rd 7030.</u> | Hawsers and Warps | " |
| Wales | " | Copper | When put on | Standing & Running Rigging | <u>Good</u> |
| Plank (Bottom) and Counter | <u>Good where seen</u> | | | | |

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. Good where seen

This vessel is in good and efficient condition -
eligible to remain as classed

The Amount of Fee.....£..... is received by me,


Special..... 1 : 1 : Rs 07/2/62

Certificate (if required) : :

Committee's Minute 7th February 1862

Character assigned 13A1

13A1
W. Mumford
Thos. W. Munn

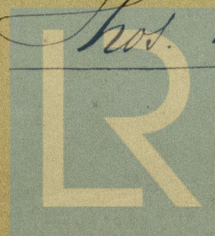

Lloyd's Register
Foundation

LON645-0169