

25580

# Change of Owners & REPORT of SURVEY for REPAIRS.

Recd 27/7/63

No. 437 Survey held at London Date 24<sup>th</sup> July 18 63 -  
 on the Schooner "Gulnare" Master H. Warwick  
 Tonnage 131 Built at P. & S. Island When built 1858  
 By whom built \_\_\_\_\_ Owners M<sup>r</sup> Coy  
 Port belonging to Port Adelaide Destined Voyage Adelaide  
 If Surveyed Afloat or in Dry Dock Bridge Dry Dock.

Last Survey, No. 25369 Port London Classified 7<sup>th</sup> 1<sup>st</sup>

## REPAIRS

Now done, the bottom Caulked and sheathed with Yellow Metal on felt, all iron rivets which came below the metal line have been renewed with Yellow Metal -

A listing has been taken out at the Plank Room for the purpose of introducing salt between the frame timbers, the heads of the timbers, especially on the hull of the bows proved to be infected with "Dry Rot" - we consequently recommended a large number of treenails to be driven out from various parts and planks to be removed in way of the defective timbers for the purpose of further examination -

## Present Condition of the

Decks	Treenails	Windlass and Capstan
Waterways	Breasthooks and Stemson	Pumps
Comings	Transoms, Pointers, and Crutches	Boats
Upper Deck Beams & Fastenings	Timbers of the Frame at the openings	Masts, Yards, &c.
Lower Deck Beams & Fastenings	Ditto Ditto at other places	Sails
Plank sheers	Keelsons	Anchors No. of
Sheerstrakes	Clamps and Shelves	Cables
Topsides	Ceiling	Hawsers and Warps
Wales	Rudder	Standing & Running Rigging
Plank (Bottom) and Counter	<u>Yellow Metal</u> <u>Copper on felt</u> When put on <u>now</u>	

## General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. ford when tested

She has been removed from the Dry Dock without complying with our recommendation - we therefore respectfully recommend her class to be suspended until she be submitted to a proper inspection and efficiently repaired

The Amount of Fee.....£ : : is received by me,

Special..... 1 : 1 :

Certificate (if required) : :

Committee's Minute 28<sup>th</sup> July 18 63

Character assigned

Exchange Character


Address - Dept. Loomby & Co

Care of M. Thornhill

24, Mark Lane

notice to owner

28/7/63

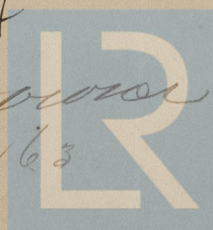

© 2021

Lloyd's Register  
Foundation

LON647-0264