

28428

# REPORT of SURVEY for REPAIRS.

No. in Reg. Book. **No.** 322 335 Survey held at London Date June 14<sup>th</sup> to 26<sup>th</sup> 1867.  
 on the Baque "Cesarea" Master J Esnouf  
 Tonnage 344 Built at Bridgewater When built 1864 (4 mo.)  
 By whom built Lough Owners J Briare and Co  
 Port belonging to Jersey Destined Voyage New Zealand  
 If Surveyed Afloat or in Dry Dock Laender dry Dock, and St Katharines Dock

Last Survey, No. 2510 Port Bristol Classed B.A. (4.64)

REPAIRS Now done.

The Yellow Metal Stripped, and on account of being wormed renewed the Fore and After Shifts of main keel with English Elm; 32 planks of the bottom and garboard with Eng<sup>l</sup> Elm and Santric Oak. Viz Port Side, Forward 11 ft., and Aft 2; Starboard Side Forward 10 ft., and aft 9: fastened with Yellow Metal bolts and Eng<sup>l</sup> oak trenails.

Hung the Ship in Shores, and Caulked from keel to the plank sheers, and reskathed the bottom with Yellow Metal on Felt.

## Present Condition of the

Decks	<i>Good where seen</i>	Treenails	<i>Good where seen</i>	Windlass and Capstan	<i>Good and sufficient where seen</i>
Waterways		Breasthooks and Stemson		Pumps <u>2</u>	
Comings		Transoms, Pointers, and Crutches		Boats <u>3</u>	
Upper Deck Beams & Fastenings		Timbers of the Frame at the openings		Masts, Yards, &c. <u>Good</u>	
Lower Deck Beams & Fastenings		Ditto Ditto at other places		Condition, how ascertained <u>imp<sup>re</sup> and anem<sup>ing</sup></u>	
Plank sheers		Keelsons		Sails	
Sheerstrakes		Clamps and Shelves		Anchors No. of <u>3 B. 1 S. 2 K.</u>	
Topsides		Ceiling		Cables	
Wales		Rudder <u>Had good</u>		Hawsers and Warps	
Plank (Bottom) and Counter		Copper <u>Mon F</u> When put on <u>now</u>		Standing & Running Rigging	
General Observations and Opinion,		Caulking of Bottom, Deck, & Waterways. <u>Good where tested.</u>			

She is now in good and efficient condition and fit in our opinion to remain Classed A.1.

The Amount of Fee.....£ 1 : : is received by me,


Special.....£ 3 . 3 . 0

Certificate (if required) : : :

Committee's Minute 16<sup>th</sup> July 1867

Character assigned 13 A 1

*record repairs*

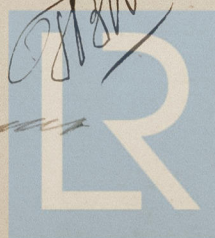

© 2021

Lloyd's Register Foundation  
LON652-0162