

Report of Survey for Repairs of Engines and Boilers.

No.

(Received at London Office, Friday, March 31, 1880)

No. in Reg. Book. Survey held at London

Date, first Survey Feb. 5th Last Survey Feb. 27th 1880

1 on the Machinery of the S.S. "Courland" (Number of Visits 4)

Tonnage, Gross 1241

Built at Glasgow

When built 1872

Ditto, Net 803

Owners D. Currie & Co.

Port belonging to Leith

Diameter of Cylinder 30" & 24"

Engines made by R. Napier & Sons, Glasgow When made 1872

Length of Stroke 36"

Boilers made by R. Napier & Sons When made 1872

Pressure of Steam 60 lb

Registered Horse Power 130

If Surveyed Afloat or in Dry Dock Afloat & Dry Dock Classified 100 A1

Last Survey No.

Port

Lloyds M.C. 3.78

Particulars of Repairs and Examination of Engines & Boilers in accordance with requirements of the rules for Special Survey No 2 for Iron ships. High and Low Pressure pistons both out examined cylinders, slide valves & valve faces, which were found to be in good condition. Crank shaft examined & found good. Air Pump & Circulating pump examined new valves fitted. Bilge & Feed pumps turned up & glands bushed. Rings in Thrust Bearing relined with White Metal. The boilers have been thoroughly repaired, new backs fitted in combustion chambers, and bottom plates in furnaces doubled. New superheater fitted. Donkey boiler thoroughly overhauled, new tubes, and new combustion chamber put in. — Examined sea connections and found all satisfactory. Propeller disconnected & tail shaft drawn in, examined same, & found in good condition the stern bush relined with lignum vitae and propeller refitted to shaft.

General Observations, Opinion, and Recommendation:— The Engines and Boilers of this ship are now in good and safe working condition and, are in my opinion eligible to be marked in the Register Book with Lloyds M.C. 2.80

Duty or Registering Fee ... £ 1 : 0 : 0

Survey Fee ... £ 2 : 2 : 0

Certificate (if required) ... £

Surveying Expenses, if any, £

received by me,


29/7/1881

Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute

Tuesday, April, 20th 1880.

Assigned

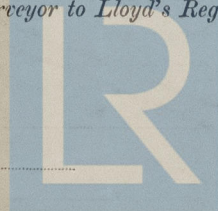

Lloyd's Register Foundation

LON 664-0246

The Machinery of this vessel has been
examined in accordance with the rules at S.S.
No 2. and is reported to be in good
condition it is submitted that she
is eligible to remain as classed and
have the notification Lloyd's M.C.
from date of last survey by -
27 Feb 1880

M 4.3.80



© 2021

Lloyd's Register
Foundation