

Report of Survey for Repairs of Engines and Boilers.

No.

(Received at London Office,

No. in
Reg. Book.

Survey held at

London

Date, first Survey

29 Nov

Last Survey

15 Dec 1881

358

on the Machinery of the

S. S. Tebrarch.

(Number of Visits

4

Tonnage, Gross

1693

Built at

S. Shields.

When built

1877

Ditto, Net

1297

Owners

M' Andrew & Co

Port belonging to

London

Diameter of Cylinder

29 1/4 58 1/4

Engines made by

Readhead & Co

When made

1877

Length of Stroke

36

Boilers made by

"

"

When made

1877

Pressure of Steam

40

If Surveyed Afloat or in Dry Dock

Afloat & in Liverpool OK

Classed

Years assigned.

Character in Register Book.

100 A 1

Registered Horse Power

140

1280

Last Survey No.

Port

Lloyds M.C. 107

Particulars of Repairs and Examination

(State cause of Repairs.)

Special Survey

Examined Cylinders slide valves & chambers & pump & found them in good condition. The crankshaft and tunnelshafting was found to be in good condition.

Examined boilers and found them in a good condition. The two wing furnaces contained some flat places in the curved furnace crown plate which have probably been there since the boiler was new. (The horizontal & vertical diameters differ only about 1/4 inch). The furnaces have been bent to their proper curvature and two half round angle-irons have been rivetted to them.

The safety valves were found to be in good condition and tested under steam to 40 lb pressure.

Examined Sea-cocks & connections & found them in good condition. The propeller contains a deep crack in the boss and has been replaced by a new one. The bottom side in chowite in stern tube has also been renewed.

General Observations, Opinion, and Recommendation:— The machinery of this vessel appears to be in good working condition and eligible in my opinion to have the Certification Lloyds M.C. 12.81 recorded in the Register Book.

Entry or Registering Fee...

£

1 : - : -

Survey Fee (per Section 28) ...

£

4 : 4 : -

received by me,

Certificate (if required)

£

- : - : -

10 June 1882

to be sent as per margin.

(Travelling Expenses, if any, £)


Committee's Minute

Friday, December, 30th, 1881.

Assigned

Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

C. H. Brown

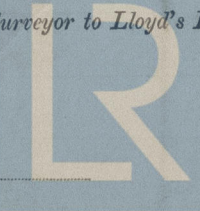

Lloyd's Register
Foundation

LONG607-0191

Submitted that- this vessel-
is eligible to have- Lloyd's M.C.
15.12.7881-

M 28.12.81

