

# Report of Survey for Repairs of Engines and Boilers.

No.

No. in Reg. Book. Survey held at London

(Received at London, 10th October, 1882.)

Date, first Survey Sept 13<sup>th</sup> Last Survey Oct 6<sup>th</sup> 1882.

424 on the Machinery of the S. S. "Glenlyon"

(Number of Visits 5)

Tonnage, Gross 2118

Built at Glasgow

When built 1872

Ditto, Net 1373

Owners McGregor Low & Co

Port belonging to Glasgow

Diameter of Cylinder 40" & 70"

Engines made by Lon. & Glas. Co.

When made 1872

Length of Stroke 43"

Boilers made by Ditto

When made 1872

Pressure of Steam 65 lbs.

If Surveyed Afloat or in Dry Dock S. S. M. Stafr.  
(State name of Dock.)

Classed 100A1

Registered Horse Power 275

Last Survey No.

Port

B & M. S. 3.81

## Particulars of Repairs and Examination For Annual Survey

(State cause of Repairs.)

Vessel placed in dry dock sea connections examined & found to be in good condition. Propeller disconnected tail shaft drawn in for examination, found to be in good condition, a built propeller has been fitted in lieu of former solid one. Stern Bush worn  $\frac{1}{4}$ ". Boilers examined (two double ended) Furnaces & Combustion chambers in good condition, Shells have had some rivets patches fitted over circumferential seams at bottom & appear to be sound, one patch now fitted at front of furnace in Port boiler, forward end. Stays found in good condition. Steam chests which pass through uptakes found to be slightly pitted in parts. A new crank shaft has been fitted. Safety Valves tested under steam to the working pressure of 65 lbs per sq. in. Engines moved under steam when every thing was found to be satisfactory.

General Observations, Opinion, and Recommendation:— As far as seen, this vessel is eligible in my opinion to remain as classed & have the notification B.S. 10. 82 recorded, provided that the boilers are again examined within 12 mths. on acct. of their age & condition.

Entry or Registering Fee... £ - : - : -

Survey Fee (per Section 23) ... £ 2 : 2 : -

Certificate (if required) ... £ : 5 : -

(Travelling Expenses, if any, £ )


received by me, J. Y. E.  
18.10.1882

Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute

Friday, 13th October, 1882.

Assigned B.S. 10. 83

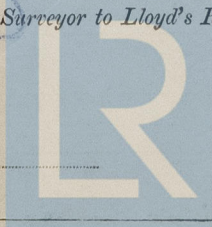

Lloyd's Register Foundation

(State if Report is also sent on the Hull of the Ship...)

(The Surveyors are requested not to write on or below the space for Committee's Minute.)

(Insert Character precisely as in the Register Book.)

10269-0129



It is submitted that this record  
is eligible to have the notation  
BS. 10.82, MS 3.87 recorded  
the books being subject  
to resurvey in 12  
months

M 10/10/82



© 2021

Lloyd's Register  
Foundation