

45168

Report of Survey for Repairs, &c., of Engines & Boilers.

(Received at London Office,)

No. 719 in Reg. Book. Survey held at London Date, first Survey 8 May Last Survey 13 June 1885
 on the Machinery of the S. S. Britannia (Number of Visits 6)
 Tonnage, Gross 973 Built at Sunderland When built 1877 10
 Ditto, Net 632 Owners Taylor & Sanderson Port belonging to Sunderland
 Diameter of Cylinder 27 50 Engines made by J. Dickinson & Co When made 1877
 Length of Stroke 33 Boilers made by Union Iron Works When made 1877
 Pressure of Steam 70 If Surveyed Afloat or in Dry Dock Union Dock (State name of Dock.)
 Registered Horse Power 98 Classed 90 A1
 Last Survey No. 3.83 Port L.M.C. 8.81.

Particulars of Repairs and Examination Special Survey and Damage
 (State clearly the cause of Repairs if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage should be separated from Repairs due to other causes. State also the dates and initials of any letters respecting this case.)

repaired.
 Examined Sea cocks & connections & found them good. The lignum vitae (lower half) has been renewed. The tail shaft was drawn and was found good.
 Examined 2 main boilers & found them in a good condition. The donkey boiler top was much corroded and has been patched.
 The safety valves were found to be in good working order.
 Examined high & low pressure slide valves & cylinder pumps & crankshaft & found them in a good condition.

General Observations, Opinion, and Recommendation:— The machinery of this vessel appears to be in a safe working condition & is in my opinion eligible to have the notification L.M.C. 6.85 recorded in the Register Book

Office or Registration Fee (per Sec. 27) £ - : - : -
 Survey Fee (per Section 28) ... 23/7/85. £ 4 : 4 : -
 Special Damage Fee (per Section 28) .. £ : :
 *Certificate (if required) £ : :
 Travelling Expenses (if chargeable) £ : :

received by me,
 11.2.1886


C. J. Brown
 Engineer Surveyor to Lloyd's Register of British and Foreign Shipping.

TUESDAY 21 JULY 1885

Committee's Minute

Assigned

M. G. A. B.

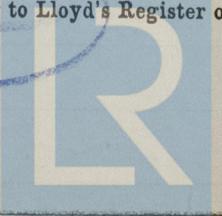

Lloyd's Register Foundation

State if a Report is also sent on the 14th of the Ship

Insert Character of Ship and Machinery precisely as in the Register Book.

It is submitted that this vessel is eligible to have the notification Lm b. 85 recorded the boilers being subject to resurvey as per Rule.

W.P.

19/6/85.



© 2021

Lloyd's Register Foundation