

Report of Survey for Repairs, &c., of Engines & Boilers.

46974

No. 46974

Port of London

(Revised at London Office.)

No. in Reg. Book. Survey held at London Date, first Survey 23 Nov Last Survey 30 Nov 1886

489 on the Machinery of the S. S. Palmyra (Number of Visits 2)

Tonnage, Gross 960 ~~2144~~ / 1382 Built at Newcastle When built 1866 1

Ditto, Net 707 ~~1382~~ Owners J Fenwick & Son Port belonging to London

Diameter of Cylinder 25 48 Engines made by R & W Hawthorn When made 1866

Length of Stroke 30 Boilers made by (2) When made 1872

Pressure of Steam 75 If Surveyed Afloat or in Dry Dock Mapping Basin Character in Register Book.

Registered Horse Power 140 (State name of Dock.) Mapping Basin Classed 90 A1

Last Survey No. 46149 Port Lon S.S. Nov 1885 4-86 13 & M 3. 3 85

Particulars of Repairs and Examination Annual Boiler Survey

(State clearly the cause of Repairs if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage should be separated from Repairs due to other causes. State also the dates and initials of any letters respecting this case.)

Examined 2 main boilers and the superheater and found them in a good condition. A few rivets in the port combustion chamber have been renewed.

The boilers were tested in my presence to 112 lb and were found to stand that pressure satisfactorily.

The safety valves (weights & levers) were found to be in good working order.

The donkey boiler is said to have been recently tested to 55 lb hydraulic pressure for the Owners satisfaction but no surveyor was called in to be present. The donkey boiler was not opened out for inspection on the present occasion.

General Observations, Opinion, and Recommendation:— As far as seen the machinery of this vessel is in a safe working condition and eligible in my opinion to have the notification B.S. 12. 86 recorded in the Register Book.

Form No. 9 - Transfer Ink - 2000, 18908


Office or Registration Fee (per Sec. 37).....	£	:	:
Survey Fee (per Section 28).....	£	2	2
Special on Damage, Fee (per Section 28).....	£	:	:
*Certificate (if required) to be sent as per margin..	£	:	:
Travelling Expenses (if chargeable).....	£	:	:

received by me, 16-2-1887

C. E. Shomeyer
Engineer Surveyor to Lloyd's Register of British and Foreign Shipping.

Committee's Minute FRIDAY 4 FEB 1887

Assigned B.S. 11.86 when the donkey boiler has been

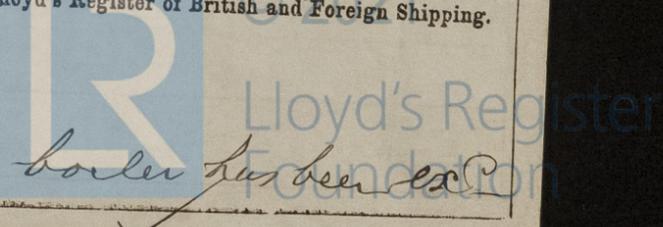

It is submitted that this vessel is eligible to have the notification B.S. 11.86 recorded when the donkey boiler has been surveyed and the main boilers as per Rule

DP
30/12/86

