


(775)

George Marshall 1100 hrs

Mr Martin's report when  
in this case, his Rules have been  
fully complied with

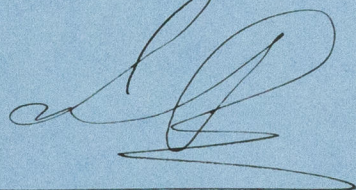

15 Sept 1854

I beg most respectfully to recommend that  
this Report be referred back to Mr Porteous for him  
to inform the Committee of the dimensions of the Shelf  
to the Upper or Spar Deck, the thickness of the  
Inside Planking between the Middle and Upper  
Deck, and in what way the Inside and Outside  
Planking is fastened in this portion of the Ship,  
also in what respect she differs from the  
Rule Sec No 41 recently made for Ships of  
Three Decks.

The thickness of Planking marked in  
Pencil requires some attention, being slightly  
under the Rules, and the Report is without  
the Builders Signature

The materials and Workmanship when seen  
by me in May last were highly creditable to  
all concerned

Sept 16/54



© 2019

Lloyd's Register  
of Shipping  
18 Sept