


*Lt. to Sunderland
6/11/82.*

S.S. 61. *Perryghent* Sld. report No 13.111


— Scantlings of Lower —
— Masts —

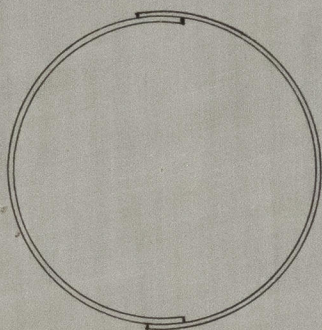

Fore Mast

Length Extreme	76' 9"
" above Deck	52' 0"
" of Housing	24' 9"
Dia at partners	23 1/2"
Thickness of plates at partners	9/16"
" " " Heel	5/16"
" " " Head	5/16"
Thickness of mast cheek plates	9/16"
Size of mast cheek angles	4 1/2" x 3" x 7/16"


Seams double riveted
Butts double riveted below partners & treble riveted above partners
Butt straps 1/16" thicker than plates they connect
Mast doubled in way of wedging for 8' 0"

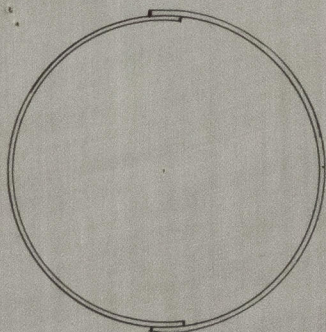

Main Mast

Length Extreme	70' 6"
" above Deck	53' 0"
" of Housing	17' 6"
Dia at partners	20"
Thickness of plates at partners	9/16"
" " " Heel	5/16"
" " " Head	7/16"
Thickness of mast cheek plates	9/16"
Size of mast cheek angles	4 1/2" x 3" x 7/16"

Seams double riveted
Butts double riveted below partners and treble riveted above partners
Butt straps 1/16" thicker than plates they connect
Mast doubled in way of wedging for 8' 0"

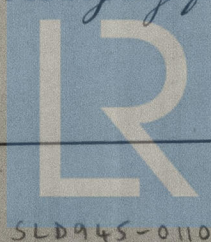

© 2021

Lloyd's Register
Foundation

October 30th 1882

*J.H.
6/11/82*