

FRI. MAR. 12. 1915

SOUTHAMPTON.

11th MARCH. 1915.

ROBERT ELLIOTT.


Messrs Smith, Sundius & Co on behalf of the owners, survey the Steel
 S.S. "BASIL" of Liverpool 3223 tons gross register, while in No 5
 dock, Southampton, on the 5th March 1915, for the purpose of
 ascertaining the damage stated to be due to the starboard cable
 starting while the vessel was anchoring in Southampton Water on the
 28th August 1914.

For further particulars see log book.

On examination the undersigned found the starboard bower anchor,
 "Lion" patent stockless anchor of forty nine hundredweights, two
 quarters and seven pounds in weight, missing also fifteen fathoms
 of two inch stud link cable lost from starboard cable.
 Recommended that the starboard bower stockless anchor be renewed
 with one at least of forty-nine hundredweights in weight, that
 fifteen fathoms of two inch stud link cable be renewed about thirty
 hundredweights in weight and that the anchor and cable be efficiently
 tested at one of the Society's Proving Houses and certificates
 be furnished for same-in order to place the vessels equipment in
 good condition as it was prior to receiving the aforementioned
 damage.

£1-1-0

Surveyor to Lloyds Register.

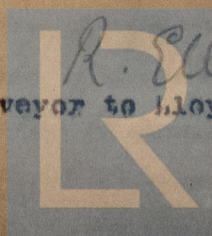

© 2021

Lloyd's Register
Foundation