

COPY.

# Lloyd's Register of Shipping.



Port

of GRIMSBY.

27th April, 1950.

### This is to Certify that

J. MACLEOD.

the undersigned Surveyor to this Society did at the request of the Owners' Representative, survey the s/s. "CYGNET", 3726 tons gross of Panama, in order to ascertain the nature and extent of damage, cause and date stated not known.

On 20th April, 1950, visited this vessel whilst in the Humber Graving Dock at Inningham and on examination found and recommended as follows:-

FOUND

Damage sustained through wire  
Shell plating starbd. side,  
'E' (Bilge) Stroke: Nos.11 & 12  
badly set up with framing, in way  
of No.2 Double Bottom Tank.

RECOMMENDED

No.11 plate to remove, fair  
and refit.  
No.12 plate to renew.  
No.2 Double Bottom Tank to open  
up, clean and framing, floors  
etc. to be dealt with as  
necessary.  
On completion, tank to test.

IT IS SUBMITTED no further

All removals necessary in order to carry out the foregoing recommendations to be afterwards replaced and made good as necessary, and all damaged or disturbed cement and paintwork to be made good as required.

Any further damage which may be disclosed in executing the repairs not enumerated to be made good as expedient.


The vessel to be restored to the same condition as before the alleged casualty occurred.

SURVEYOR TO LLOYD'S REGISTER OF SHIPPING.

Fee:- £2 : 2: 0d.

Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:-  
The Committees of the Society use their best endeavours to ensure that the functions of the Society are properly performed and it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any publication of the Society, or for any error of judgment, default or negligence of any of its Members or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."

10m,7,43. (MADE AND PRINTED IN ENGLAND.)

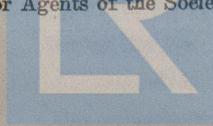

Lloyd's Register Foundation

Travelling expenses (if chargeable) £ - : - : -

Engineer Surveyor