

# Lloyd's Register of British & Foreign Shipping

71, Fenchurch Street,

London, 20<sup>th</sup> February

1905

E.C.

10 MAR 1905


21 MAR 1905

Surveyor at

Buenos Ayre

Name

Forestal

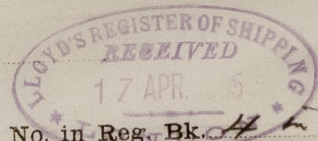

No. in Reg. Bk. 4 in Supp.

QUESTION.

ANSWER.

to have stranded at  
on the 6<sup>th</sup> instant.

feel much obliged if  
it kindly ascertain & let  
us know whether the vessel has  
been refloated. If so, will  
be good enough to state, in  
terms, the nature & extent  
of damage the vessel has  
suffered, & also say what  
repairs have been made  
in making the repairs.

re reply be return mail.

A. Scott  
Secretary

Vessel towed out by 4s  
Chile, both stranded on date  
given & have since been re  
floated & are now in W. As  
Damage visible, stem head  
bent, starboard bulwarks badly  
buckled, considerable deck  
damage, skids, boats, bulwark  
stanchions buckled, deck fore  
No. 1 hatch to foremast set down  
Bottom apparently damaged  
aft end No 2 hatch longitudinal  
division badly buckled about  
12 ft. Will discharge cargo  
& dry down & be placed  
on slip. Negotiations re  
salvage delaying start  
of repairs.

W. H. Wilton

form is to be returned to the Secretary as soon as the information asked  
for has been filled in.

Lloyd's Register  
Foundation  
W1449-0023