

Register of British & Foreign Shipping.
EYS FOR FREEBOARD.—STEAM SHIPS.

TO ALL STEAM SHIPS EITHER FLUSH DECKED, OR WITH
FILES, SHORT POOPS AND BRIDGE HOUSES DISCONNECTED, OR
FORECASTLES HAVING LONG POOPS, OR RAISED QUARTER DECKS
CONNECTED WITH BRIDGE HOUSES, OR OTHERWISE.

Port of Survey *Belfast*
Date of Survey *5 July 1910*
Name of Surveyor

Name *Bank & Co* Port of Registry and Nationality. Official Number. Gross Tonnage. Date of Build. Particulars of Classification.
100A.1. Shaded deck contemplated

Registered Dimensions from Ship's Register.	LENGTH.	BREADTH.	DEPTH.	UNDER DECK Tonnage.
	<i>410.5</i>	<i>52.6</i>	<i>24.7</i>	
Length on LOADLINE	<i>409.5</i>	Frame Depth <i>8</i> Rule " <i>5½</i>	Ceiling <i>2</i> Sheer <i>7</i> <i>Drop plank 4"</i> <i>= +.16</i> <i>Ceiling under hatches & over timbers only</i>	Peak Tanks
CORRECTED DIMENSIONS.				

Co-efficient of fineness
Any modification necessary {
[Para. 4 (a) to (e) *]
Co-efficient as corrected *.66 Given by Builders*

Sheer { Stem... *98*
at { Sternpost... *55* } $153 \div 2 = 76.5$ Mean
Sheer at $\frac{1}{2}$ of the length from { Stem *54*
Sternpost *30* } $84 \div 2 = 42$ Mean
Gradual mean Sheer *76.36*
Standard mean Sheer (Table, Para. 18) *50.95* Correction ✓
Difference..... $25.41 \div 4 = -6\frac{1}{4}$
§ If limited as Para. 18 (f)..... *6.35*

Rise in Sheer { At front of bridge house.....
from amidships {
[Para. 18 (e)] { At after end of forecastle

¶ Fall in shear {
Para. 18 (d) } $\div 2 =$
Length uncovered Correction

ALLOWANCE FOR DECK ERECTIONS:—

Freeboard, Table C..... *61* *3 1½*
Correction for Length, if required (Para. 12, 13, and 14)
Freeboard by Table A. corrected for sheer, and for length, if required (Para. 12, 13, and 14) *5 7½*
Difference *2 6*
Percentage as below..... *53.2%*
15.91
= 16

Correction for R. Q. Dk. if engine and boiler openings not covered by bridge house (Para. 11)
Allowance for Deck Erections

	Length.	Length allowed.	Height.
Forecastle.....	<i>62</i>	<i>56.6</i>	<i>8.0</i>
Bridge House.....	<i>15</i>	<i>7.5</i>	
† Raised Qr. Dk. shelter.....	<i>208</i>	<i>199.25</i>	
Poop.....	<i>15</i>	<i>7.5</i>	
Total.....	<i>332.3</i>	<i>299.85</i>	
Length of Ship.....	<i>409.5</i>	<i>409.5</i>	<i>.732</i>
Corresponding percentage { (Para. 12, 13, or 14) }	<i>53.2%</i>		

FREEBOARD recommended amidships from centre of Disc to top of Statutory Deck Line, Wood (Iron) Deck:—

Fresh Water Line above centre of Disc ...
Indian Summer Line " " *Amended Tables* ...
Winter Line below " *March, 1906* ...
Winter North Atlantic Line " " " ...

Moulded Depth as measured..... *24.3*

NOTE.—If the depth is measured when vessel is afloat, the details of measurement should be reported

CORRECTION FOR LENGTH.
Length of Ship on Loadline..... *409.5*
Length in Table *327*
Difference *82.5*
Correction for 10ft., Table A. *1.4* Table C.
× Difference divided by 10 *11.55* (if required.)
If $\frac{5}{16}$ ths length covered divide by 2 *+ 5¾*

CORRECTION FOR IRON DECK.
Proportion covered, if less than $\frac{1}{16}$ ths length covered
Thickness of usual wood deck, less stringer..... *3½*
3" Sheathing Correction - ½

CORRECTION FOR ROUND OF BEAM.
Breadth at Gunwale amidships..... *51.9*
Round of Beam..... *13*
Normal round *12.94*
Difference $\div 2 =$
Proportion of Deck uncovered (Para. 19)

NOTE.—The round of beam should be reported on the full breadth of vessel at the gunwale.

Freeboard, Table A *6 1¾*
Correction for Sheer *6.35* *- 6¼*
Correction for Length *5 7½* *+ 5¾*
Allowance for Deck Erections *1 4* *4 9¼*
Correction for Round of Beam.....
Correction for fall in Sheer (if any)
3" Sheathing on
Correction for Iron Deck (if required) *- ½*
Additions for non-compliance with provisions of {
Para. 11 (d) and (e) † }
Other Corrections (if any).....

Winter Freeboard *4 8¾*
Summer Freeboard *4 3¼*
Indian Summer Freeboard *3 9¾*
~~N. A. Winter Freeboard~~
Correction necessary because clearside amidships, measured in accordance with the Statute, is not taken at the intersection of the wood or iron deck with side. *1 ¼*

Winter Freeboard from deck line *4 10½*
Summer " " " " *4 5*
Indian Summer " " " " *3 11½*
~~N. A. Winter~~ " " " "

* If the frames, skin planking, or ceiling are of unusual thickness the breadth of vessel to inside of ceiling should be reported if possible.
† In vessels obtaining an allowance for deck erections under Para. 11 where the sheer drops abaft amidships the height of the R.Q.D. is to be taken from the level of the top of the amidship beam.
§ In flush-decked vessels the total standard mean sheer means the sheer measured at the stem and sternpost. In vessels having poops and forecastles, it means the sheer measured at points distant one-eighth of the vessel's length from stem and sternpost.

† State dimensions of freeing port area on back of this form.
¶ The Surveyor should state whether the fall in sheer as reported is measured relatively to the straight line of keel or to the water line. If measured relatively to water line the vessel's draft at time of survey, and also the usual load draft forward and aft, should be reported.

House? *yes* Forecastle?
in way of Upper Bridge

Raised Quarter Deck?

ouse? *Yes* Forecastle?
in way of Upper Bridge

Has the Poop or Raised Quarter Deck an efficient Iron Bulkhead at the fore end?

Has the Poop or Raised Quarter Deck an efficient Iron Bulkhead at the fore end?

Give particulars of the means for closing the openings in Bulkhead

Is the Poop or Raised Quarter Deck connected with the Bridge House?

Give particulars of the means for closing the openings in Bulkhead

What is the thickness of the Bridge Front plating? _____ and Coaming plate? _____

Give scantlings and spacing of the Stiffeners

Are bracket plates fitted at each end of the Stiffeners?

Has the Bridge House an efficient Iron Bulkhead at the after end?

How are the openings closed?

Is the Forecastle at least as high as the main or top-gallant rail?

Are the Engine and Boiler openings covered by a Bridge, Poop, Raised Quarter Deck, or enclosed by a Strong Iron or Steel Deckhouse?

If the openings are not so protected are the exposed parts of the Casings efficiently constructed?

Give thickness of plating; scantlings and spacing of Stiffeners

What is the height of the exposed Casings?

Are suitable means provided for closing all openings in them in bad weather?

Are the Weather Deck Hatchways efficiently constructed and at least equal to the requirements of Section 28 of the Rules for 1904-5? Give particulars below:—

the Weather Deck Plating and requirements of Section 28 of the Rules for 1904-5? Give particulars below:—

Position and Size.											
	Item.	Ship.	Rule.	Ship.	Rule.	Ship.	Rule.	Ship.	Rule.	Ship.	Rule.
COAMING.	Height above top of DECK.....										
	Thickness { Sides..... Ends.....										
STIFTING BEAMS OR WEB PLATES.	Number.....										
	Section and Scantlings.....										
	Material.....										
FORE AND AFTERS.	Number.....										
	Section and Scantlings.....										
	Material.....										
HATCHES	Thickness.....										
	Remarks.....										

and the depth should be stated from the underside of the hatches.

* When the Fore and Afters are of wood the depth should be stated from the underside of the hatches.

(If the sill of the lowest side scuttle will be less than 6 inches above the Indian Summer Load Line if assigned under the tables, state vertical distance from top of deck at side amidships to lower edge of lowest side scuttle.)

The following information is to be given in all Cases of vessels dealt with under Paras. 11, 12 (under 15 feet Moulded depth) and under Shelter Deck Rules.

What is the thickness of the Bridge Sheerstrake?

Strake between Main and Bridge Sheerstrakes?

Delete the words that do not apply

{	The Crew <i>are, are not</i> berthed in the bridge house.
	The arrangements to enable them to get backwards and forwards from their quarters <i>are, are not</i> satisfactory.

Length of Bulwarks in well

Area of Freeing Ports required by Para. 11 (e) each side of vessel

Sq. ft.


Ft.	Tenths.	Ft.	Tenths.	No.	Freeing Ports (each side of vessel)
×				×	
×				×	

Freeing Ports
(each side of vessel)

Sq. ft.

Total deficiency or excess

Sq. ft.

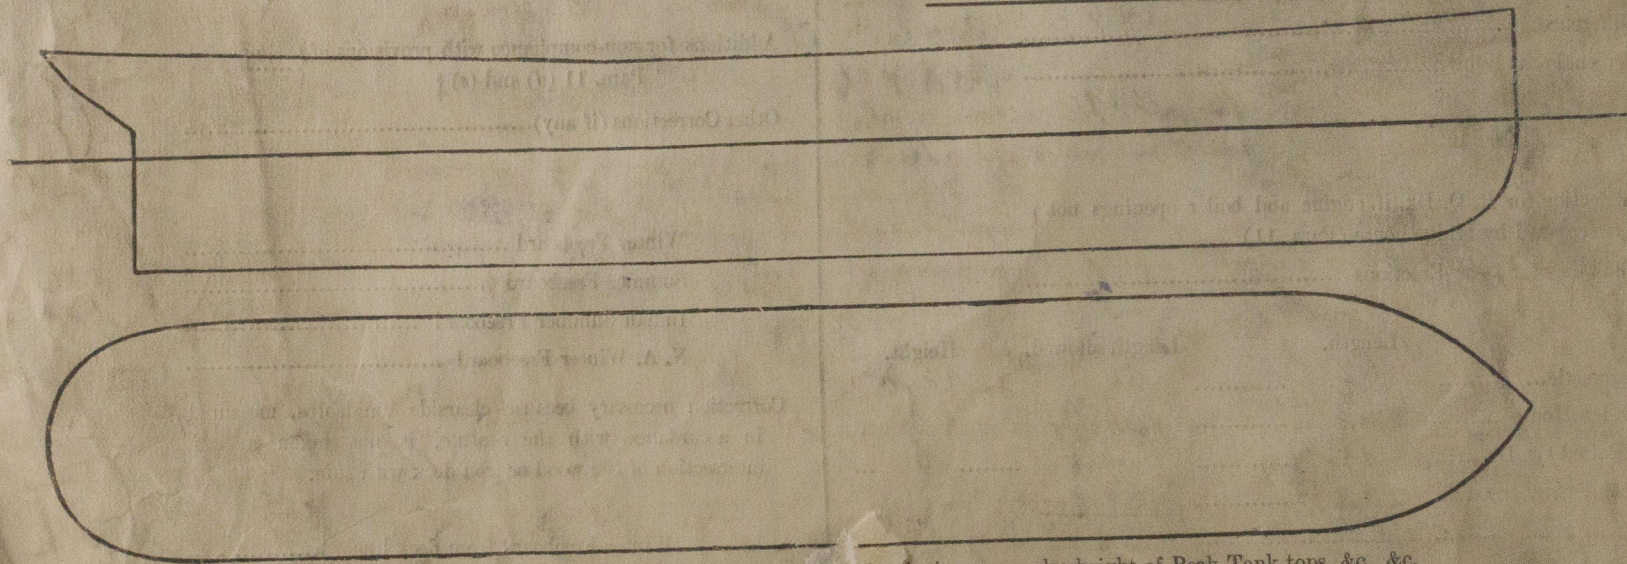

Show hereon line of Floors or Tank Top with position of Breaks in same; also height of Peak Tank tops, &c., &c.

State any special features in the construction of the Vessel

Owners

Address

Rec £

Received by me

Lloyd's Register
Foundation