

Received from Chief Surveyors

Chief Surveyors 25.4.35

L'S NAME

SHS "SANTA CELIA"

Report

Sea

No. 2616

For the CHIEF SHIP SURVEYOR and CHIEF ENGINEER SURVEYOR.

(In cases which have to be submitted to the Classing Committee "the endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case so that the Classing Committee may have all the salient points presented in the endorsement." - (Extract from Sub-Committee's Report, 24/5/92.)

(A No. 3 SURVEY PARTLY HELD. after an early No 3)

4.35

When proposed to be completed

(In May or June of this year) Damage
see previous endorsement


due

Survey held, &c.

Ex "afloat" of ice damage

To complete the Survey: - All rule requirements except internal examination of fore peak + No 1 + 2 d b tank.

Subject to a shell plate on starboard side in way of fore peak (EN 3.34) being specially examined or renewed, to pitted keel plating being specially examined at the next dry docking + to bottom + sides of ship being sealed for proper examination of shell, keel plating + riveting when ship is next dry docked for Special Survey, slight indent at fore mast + No 2 hatch to be further examined in drydock (after ice damage.)

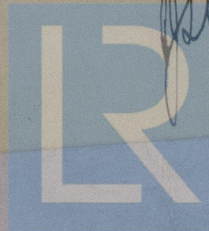

© 2021

W561-0239

Lloyd's Register
Foundation