

RETAIN

LLOYD'S REGISTER OF SHIPPING.

Head Office, 71 Fenchurch Street. London.E.C.

Port. New Orleans.

June 24th. 1915.

Copy

This is to Certify that

J Miller Buchanan

the undersigned Surveyor to this Society ~~XXXXXXXXXXXXXXXXXXXX~~ and A.E.Wilson did at the request of Owners Representatives and Marshall J Smith & Co. Lloyds & Underwriters Agents, make examination of the steel screw steamer "MAROWIJNE" of New York, 3191 tons gross register on June 22nd.1915 while the vessel was in dry dock at New Orleans, for the purpose of ascertaining the nature and extent of damage stated to have been sustained through the propeller having struck a submerged object in the Mississippi River on June 20th. 1915 while on a voyage from Belize to New Orleans; The shock caused the engines to vibrate.

For further particulars see Log Books and Protest.

On examination of vessel and propeller in dry dock, found, Three bronze blades of the built propeller bent at the tips, one blade bent at tip and a piece broken off about 19" x 3" ~~RECOMMEN~~ The cone for the propeller nut missing.

RECOMMENDED. The bent tips of three blades to be faired in place. the tip of one blade to be dressed and faired as far as possible. It is also recommended that a new bronze blade be supplied and fitted at the first convenient opportunity, also a new cone.

In our opinion the vessel is in fit condition to proceed on her contemplated voyage.



© 2021

Lloyd's Register Foundation

W838-0017 1/2

This  
copy  
sent  
to  
Date

"MAROWIJNE"

(2).

Given under our hands this 24th. day of June, 1915.

*J. Miller Buchanan*


Surveyor

Lloyds Register of Shipping.

*A. E. Wilson*

Surveyor

Lloyds & Underwriters Agent.

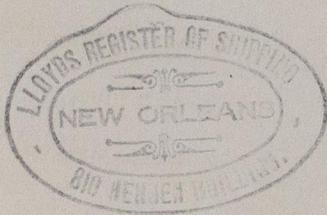

© 2021

Lloyd's Register  
Foundation

W838-0017  $\frac{2}{2}$