


BULWARK BUTTS MARKED
SHEERSTRAKE " "

FROM FRAME 19 TO 26 BEAMS SCARPHED 15" INSIDE OF BUNKER
TO ALLOW FOR SHIPPING BOILER (ON BOTH SIDES)

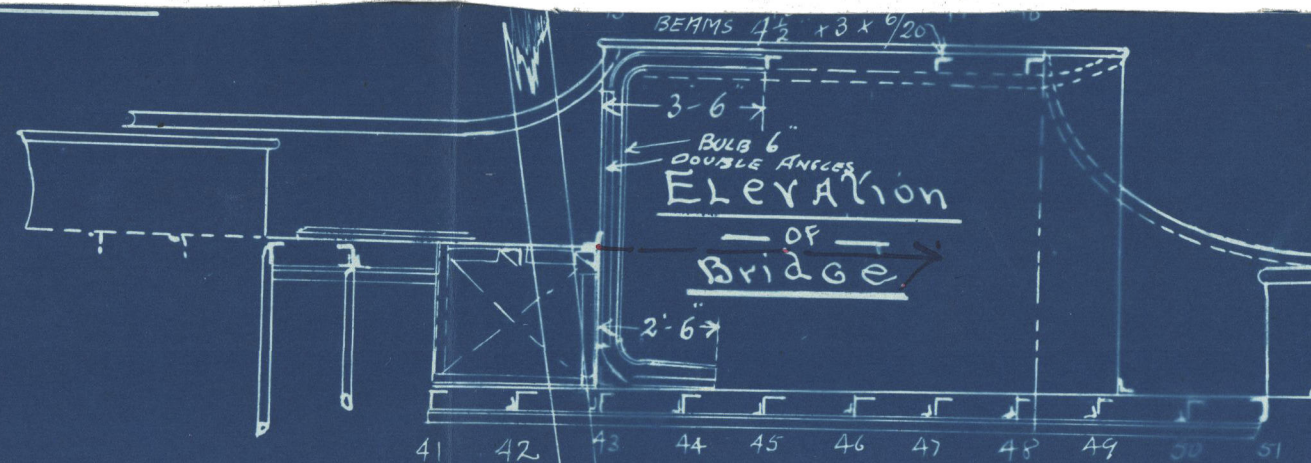

FROM 2 TO 8 BEAMS $6\frac{1}{2} \times 3 \times 9/2$

STRONG BEAM 6" x 3" x 9/20
DOUBLE BULB ANGLES

BEAMS $6\frac{1}{2} \times 3 \times 9/20$ \rightarrow

7x3x 9/20 BULB ANGLE

BEAMS ON WEB FIRM $7 \times 3 \times 9/16$ BOLT 1 IN DIA

DECK FLANGE PUNCHED W.T

7x3x9/20 BULB ANGLE

7'3" + 9/20" BULB ANGLE -

FROM T3 TO STEM BEAMS $6 \times 3 \times 9/20$.

DECK FLANGE
PUNCHED W.T.

VERTICAL FLANGE PUNCHED
TO TAKE COAMING.

43 44 45 46 47 48
DECK FLANGE PUNCHED IN



VERTICAL FLANGE PUNCHED TO TAKE COAMING

DECK FLANGE
PUNCHED W.T.

Messrs John
Luther Sons & Coys.
No. 238

Deck Plan

S.S. "Alastair"
Abn. Apt. No. 7358

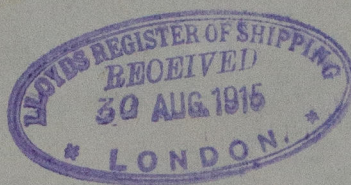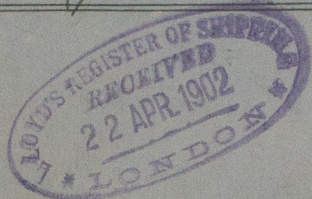

RETAI

W974-0125



copy of



© 2020

Lloyd's Register
Foundation