

REPORT ON ELECTRIC FITTINGS.

(OTHER THAN FOR THE PROPULSION OF THE VESSEL)

Received at London Office

WED FEB 6 1924

Date of writing Report *Feb 5th 1924* When handed in at Local Office *Feb 5th 10 24* Port of *Bristol*

No. in Survey held at *Appl. on* Date, First Survey *Dec 11th* Last Survey *Jan 22nd 1924*
 Reg. Book. on the *S. WHEATCROP.* (Number of Visits *5*)

Built at *Belfast* By whom built *Hansen S.B. & Co.* Yard No. *9* Tons { Gross *522.64*
 Owners *Spillers Steamship Co.* Port belonging to *Cardiff* Net *199.08*
 Electric Light Installation fitted by *Hansen Shipbuilding & Co.* Contract No. When fitted *1924.*

System of Distribution *Two wired direct*

Pressure of supply for Lighting *100* volts, Heating *none* volts, Power *none* volts.

Direct or Alternating Current, Lighting *Direct* Power *none*

If alternating current system, state frequency of periods per second *—*

Has the Automatic Governor been tested and found efficient when the whole load is suddenly thrown on or off *Yes*

Generators, do they comply with the requirements regarding overload *Yes*, are they compound wound *Yes*

are they over compounded 5 per cent. *Yes*, if not compound wound state distance between each generator *—*

Where more than one generator is fitted are they arranged to run in parallel *—*, is an adjustable regulating resistance fitted in series with each shunt field *—*

Are all terminals accessible and clearly marked *Yes*, are they so spaced or shielded that they cannot be accidentally earthed, or short circuited *Yes* Are the lubricating arrangements of the generators as per Rule *Yes*

Position of Generators *Engine Room Starboard side*

is the ventilation in way of the generators satisfactory *Yes*, are they clear of all inflammable material *Yes*

if situated near unprotected woodwork or other combustible material, state distance of same horizontally from or vertically above the generators *—* and *—*, are the generators protected from mechanical injury and damage from water, steam or oil *Yes*

are their axis of rotation fore and aft *Yes*

Earthing, are the bedplates and frames of the generating plant efficiently earthed *Yes* are the prime movers and their respective generators in metallic contact *Yes*

Main Switch Boards, where placed *Engine Room adjacent to Generator*

If the generators and main switchboard are not placed in the same compartment, is each generator provided with a fuse on each insulated pole as near as possible to the terminals of the generator, additional to that provided on the main switchboard *—*

Switchboards, are they placed in accessible positions, free from inflammable gases and acid fumes *Yes*

are they protected from mechanical injury and damage from water, steam or oil *Yes*, if situated near unprotected woodwork or other combustible material, state distance of same horizontally from or vertically above the switchboards *—* and *—*

are they constructed wholly of durable, incombustible non-absorbent materials *Yes*, is all insulation of high dielectric strength and of permanently high insulation resistance *Yes*, if semi-insulating material is used, are all conducting parts connected to one pole insulated from the slab with mica or micanite and the slab similarly insulated from its framework *—*, and is the frame effectively earthed *Yes*

Are the following fittings as per Rule, viz.: — spacing or shielding of live parts *Yes*, accessibility of all parts *Yes*, absence of fuses on back of board *Yes*, proportion of omnibus bars *3/4" x 3/16"*, individual fuses to voltmeter, pilot or earth lamp *Yes*, connections of switches *Yes*

Main Switchgear, description of switchgear for each generator and each outgoing circuit, and arrangement of equalizer switches


Single pole switch for each outgoing circuit & double pole switch for generator

Instruments on main switchboard *one* ammeters *one* voltmeters *no* synchronising device for paralleling purposes.

Earth Testing, state what means are provided at the main switchboard for indicating the state of the insulation of the system *Two earth lamps with switch & fuses*

Switches, Circuit Breakers and Fusible Cut-outs, do these comply with the requirements of the Rules *Yes*

Section and Distribution Boards, is the construction, protection, insulation, material, and position of these as per rule *Yes*

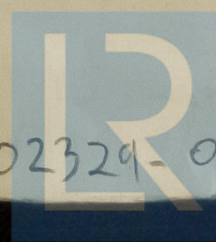

© 2020

002320-002329-0054

Lloyd's Register
Foundation

If portable lamps for use in dangerous spaces are supplied, are they of a type approved by the Home Office.....

[illegible]

All Conductors are of annealed copper conforming to British Standard Specification No. 7.

The Insulated Conductors are guaranteed to withstand the immersion and resistance tests specified in the Rules.

The foregoing is a correct description.

For and on behalf of

THE HANSEN SHIPBUILDING & REPAIRING CO. LTD.

Electrical Engineers.

Date

1 Feb 1924

COMPASSES.

Distance between electric generators or motors and standard compass 90 ft.

Distance between electric generators or motors and steering compass 90 ft.

The nearest cables to the compasses are as follows:—

A cable carrying 5 Ampères 12 feet from standard compass 12 feet from steering compass.

A cable carrying 4 Ampères 15 feet from standard compass 15 feet from steering compass.

A cable carrying 3 Ampères 30 feet from standard compass 30 feet from steering compass.

Have the compasses been adjusted with and without the electric installation at work at full power Yes

Has the effect of switching on and off circuits, motors and other electro-magnetic apparatus within the vicinity of the compasses been noted Yes

The maximum deviation due to electric currents was found to be — degrees on — course in the case of the standard

compass, and — degrees on — course in the case of the steering compass.

For and on behalf of

THE HANSEN SHIPBUILDING & REPAIRING CO. LTD.

J. B. Bratton

Builder's Signature.

Date

1 Feb '24

Is this installation a duplicate of a previous case No If so, state name of vessel —

General Remarks (State quality of workmanship, opinions as to class, &c.)

This installation of electric light has been tested in accordance with the Rules and under full working conditions with satisfactory results. The materials and workmanship are good.

It is submitted that
this vessel is eligible for
THE RECORD. Elec. light.

J. W. D.
24/3/24

Total Capacity of Generators THREE Kilowatts

The amount of Fee ...

£ 5 : 0

When applied for,

Set 5/19/24

Travelling Expenses (if any) £ :

When received,

Set 5/19/24

John L. Gwynne

Surveyor to Lloyd's Register of Shipping.

Committee's Minute

FRI FEB 8 1924

Assigned

Im. 9. 2. 2. — Transfer.

(The Surveyors are requested not to write on or below the space for Committee's Minute.)



© 2020

Lloyd's Register
Foundation