

For the information of Surveyors and the Committee only.

Received at _____ Office _____ 19__

Lloyd's Register of Shipping.

Order: 35586/St
Post: 4271
Best: 1553

(Report on Vessel No. _____ Port _____)

No. 310 SHIP ~~FORGINGS~~ OR CASTINGS.

I have to report that the undermentioned Iron or Steel ~~Forgings~~ Castings, manufactured by Messrs. Witkowitz Bergbau & Eisenh. Gew. of Witkowitz for the Vessel No. 586, being built by Messrs. G. van der Giessen & Zonen of ~~Krispen~~ Krispen a.d. Ysel have been inspected by me as set forth below and found to be, so far as can be seen, 2 propeller brackets, sound and free from defects

~~in Forgings~~ Castings.

Lloyd's

Vienna, 12th March 1928

No. 2804 7934/35

HK. 9.3.28

Hans Kolbow.


Propeller brackets

	1 STEM FRAME	1 RUDDER FRAME	STEM.
Material*	Siemens Martin Steel	Siemens Martin Steel	
How made	cast	cast	
annealed	annealed	annealed	
Dimensions	to sketch	to sketch	
Progress on Inspection	almost finished	almost finished	
Date when Inspected	23.2; 9.3.28	23.2; 9.3.28	
CASTINGS.	7934	7935	
Tests on Standard Test Pieces.			
Tensile Test—			
Tons per square inch	31.6 29.7	27.9 28.2	
Extension per cent. ...	33.6 32.9	36.8 36.8	
Cold Bending Test—	120 degree good		
Angle before fracture			
Drop Test—	dispensed with		
Height from ground ...			
Hammering Test—	satisfactory		
If made according to Rules (and found satisfactory ...)			

SKETCHES OF FRAMES SHOWING POSITION AND DESCRIPTION OF WELDS OF FORGINGS.

Fee (if any chargeable) £ : :

To be paid at VIENNA

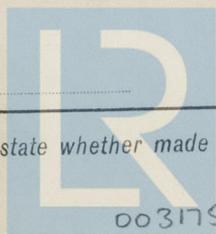

© 2020

Lloyd's Register Foundation

* If of Iron, state whether scrap or puddled Iron. If of Steel, state whether made on the Open Hearth process.