

REPORT ON ELECTRICAL EQUIPMENT.

(OTHER THAN FOR THE PROPULSION OF THE VESSEL)

Received at London Office 27 FEB 1935

Date of writing Report 10 Feb 19 35 When handed in at Local Office 19 Port of Amsterdam
 No. in Survey held at Amsterdam Date, First Survey 19 Dec 24 Last Survey 11 Feb 19 35
 Reg. Book. Amsterdam (Number of Visits 21)
 on the Twin Screw Steamer "ROSA" Tons { Gross 2145.26
 Net 1554.79
 Built at Amsterdam By whom built Ned. Schipb. M^r Yard No. 882 When built 1935
 Owners Curacao'sche Scheepvaart N^o Port belonging to Willemstad (West Indies)
 Electric Light Installation fitted by H. V. Groenewald & d. Polle & Co Contract No. When fitted 1935
 Is the Vessel fitted for carrying Petroleum in bulk Yes

System of Distribution Double wire

Pressure of supply for Lighting 100 ✓ volts, Heating ✓ volts, Power 110 ✓ volts.

Direct or Alternating Current, Lighting Direct current ✓ Power Direct current ✓

If alternating current system, state frequency of periods per second ✓

Has the Automatic Governor been tested and found efficient when the whole load is suddenly thrown on or off Yes ✓

Generators, do they comply with the requirements regarding temperature rise Yes ✓, are they compound wound Yes ✓
 are they over compounded 5 per cent. Yes ✓, if not compound wound state distance between each generator

Where more than one generator is fitted are they arranged to run in parallel one ✓, is an adjustable regulating resistance fitted in series with each shunt field Yes ✓

Have certificates of test results for machines under 100 kw. been submitted and approved attached ✓ Have machines over 100 kw. been inspected by the Surveyors during manufacture and testing ✓

Are all terminals accessible, clearly marked, and furnished with sockets Yes ✓, are they so spaced or shielded that they cannot be accidentally earthed, short circuited, or touched Yes ✓

Are the lubricating arrangements of the generators as per Rule Yes ✓

Position of Generators In engine room S B side ✓, is the ventilation in way of the generators satisfactory Yes ✓ are they clear of all inflammable material Yes ✓ if situated near unprotected

woodwork or other combustible material, state distance of same horizontally from or vertically above the generators none ✓ and ✓
 are the generators protected from mechanical injury and damage from water, steam or oil Yes ✓, are their axes of rotation fore and aft Yes ✓

Earthing, are the bedplates and frames of the generating plant efficiently earthed Yes ✓ are the prime movers and their respective generators in metallic contact Yes ✓

Main Switch Boards, where placed in engine room S B side ✓
 If the generators and main switchboard are not placed in the same compartment, is each generator provided with a fuse on each insulated pole as near as possible to the terminals of the generator, additional to that provided on the main switchboard ✓

Switchboards, are they placed in accessible positions, free from inflammable gases and acid fumes Yes ✓, are they protected from mechanical injury and damage from water, steam or oil Yes ✓

if situated near unprotected woodwork or other combustible material, state distance of same horizontally from or vertically above the switchboards none ✓ and ✓, are they constructed wholly of durable, non-ignitable non-absorbent materials Yes ✓

is all insulation of high dielectric strength and of permanently high insulation resistance Yes ✓, is it of an approved type Yes ✓

if semi-insulating material is used, are all conducting parts insulated from the slab with mica or micanite or other non-hygroscopic insulating material, and the slab similarly insulated from its framework none ✓, is the non-hygroscopic insulating material of an approved type ✓

and is the frame effectively earthed Yes ✓. Are the fittings as per Rule regarding:— spacing or shielding of live parts Yes ✓, accessibility of all parts Yes ✓, absence of fuses on back of board Yes ✓, temperature rise of omnibus bars Yes ✓, individual fuses to voltmeter, pilot or earth lamp Yes ✓, are moving parts of switches alive in the "off" position Yes ✓


are all screws and nuts securing connections effectively locked Yes ✓ are any fuses fitted on the live side of switches Yes ✓

Are turbine driven generators fitted with emergency trip switch as per rule none ✓ Are cupboards or compartments containing switchboards composed of fire-resisting material or lined with approved material brass cast ✓ Instruments on main switchboard 1 ✓ ammeters 1 ✓

voltmeters ✓ synchronising device for paralleling purposes. For compound machines is the ammeter connected on the opposite pole to equaliser connection ✓

Earth Testing, state what means are provided at the main switchboard for indicating the state of the insulation of the system Two lamps in series connected with the earth ✓

Switches, Circuit Breakers and Fusible Cut-outs, do these comply with the requirements of the Rules Yes ✓ are the fusible cutouts of an approved type Yes ✓ have the reversed ✓

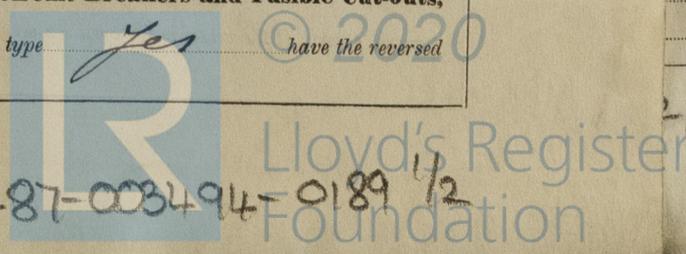

current protection devices been tested under working conditions. **Joint Boxes, Section and Distribution Boards**, is the construction, protection, insulation, material, and position of these as per rule *Yes*

Cables: Single, twin, concentric, or multicore *various types* are the cables insulated and protected as per Tables IV, V, X or XI of the Rules *Yes*

If the cables are insulated otherwise than as per Rule, are they of an approved type *none* **Fall of Pressure**, state maximum between bus bars and any point of the installation under maximum load *2 volts for light & 5 volts for power* **Cable Sockets**, are the ends of all cables having a sectional area of 0.04 square inch and above provided with soldering sockets. *Yes* **Paper Insulated and Varnished Cambric Insulated Cables.**

If conductors are paper or varnished cambric insulated, is the dielectric at the exposed ends of the conductor protected from moisture by being suitably sealed with insulating compound *none*, or waterproof insulating tape *✓* **Cable Runs**, are the cables fixed as far as possible in accessible positions not exposed to drip or accumulation of water or oil, or to high temperature from boilers, steam pipes, uptakes or other hot objects, or to avoidable risk of mechanical damage *Yes* Are cables in machinery spaces, galleys, laundries, bathrooms and lavatories lead covered or run in conduit *lead covered*

Support and Protection of Cables, state how the cables are supported and protected *Steel plates and fixed with galvanised iron clips & brass screws*

If cables are run in wood casings, are the casings and caps secured by screws *none*, are the cap screws of brass *✓*, are the cables run in separate grooves *✓* If armoured and lead covered cables are secured by metal clips, are the clips spaced as per Table VIII *Yes*

Refrigerated Chambers, are the cables and fittings in accordance with the special requirements. *Yes*

Joints in Cables, state if any, and how made, insulated, and protected *no joints*

Watertight Glands and Deck Tubes, are all cables passing through decks and watertight bulkheads provided with deck tubes or watertight glands *Yes* **Bushes in Beams and Non-watertight Partitions**, where unarmoured cables pass through beams and non-watertight partitions, are the holes efficiently bushed *Yes* state the material of which the bushes are made *lead*

Earthing Connections, state what earthing connections are fitted and their respective sectional areas *connected to frame*

are their connections made as per Rule

Alternative Lighting, are the groups of lights in the propelling machinery space arranged as per Rule *Yes* **Emergency Supply**, state position and method of control of the emergency supply and how the generator is driven *none*

Navigation Lamps, are these separately wired *Yes*, controlled by separate switch and separate fuses *Yes*, are the fuses double pole *Yes*, are the switches and fuses grouped in a position accessible only to the officers on watch *Yes*

has each navigation lamp an automatic indicator as per Rule *Yes* **Secondary Batteries**, are they constructed and fitted as per Rule *none*

Fittings, are all fittings on weather decks, in stokeholds and engine rooms and wherever exposed to drip or condensed moisture, watertight *Yes* are any fittings placed in spaces in which goods are liable to be stacked in close proximity to them; if so, how are they protected *none*

are any fittings placed in spaces where inflammable or explosive dust or gases are liable to be present, if so, how are they protected *two lamps in pump room protected by gas tight lock up boxes outside the pump room protected by gas tight tubes where are the controlling switches situated on platform aft etc*

are all fittings suitably ventilated *Yes*, are all switches and lampholders constructed wholly of non-ignitable, non-absorbent materials. *Yes*

Heating and Cooking Appliances, are they constructed and fitted as per Rule *none*, are air heaters constructed and fitted as per Rule *✓*

Searchlight Lamps, No. of *none*, whether fixed or portable *✓*, are their fittings as per Rule *✓*

Arc Lamps, other than searchlight lamps, No. of *none*, are their live parts insulated from the frame or case *✓*, are their fittings as per Rule *✓*

Motors, are their working parts readily accessible *Yes*, are the coils self-contained and readily removable for replacement *Yes*, are the brushes, brush holders, terminals and lubricating arrangements as per Rule *Yes*, are the motors placed in well-ventilated compartments in which inflammable gases cannot accumulate and clear of all inflammable material *Yes*, are they protected from mechanical injury and damage from water, steam or oil *Yes* are their axes of rotation fore and aft *Yes*, if situated near unprotected woodwork or other combustible material, are the motors of the totally enclosed, pipe ventilated, forced-draught, drip or flame proof type *Yes*, if not of this type, state distance of the combustible material horizontally or vertically above the motors *✓* and *✓*

have machines of over 100 BHP been inspected by the Surveyors during manufacture and testing *none* **Control Gear and Resistances**, are the generator field and motor speed regulators, starters and controllers constructed and fitted as per Rule *Yes* **Lightning Conductors**, where lightning conductors are required, are these fitted as per Rule *Yes* **Ships carrying Oil having a Flash Point less than 150° F.** Have the special requirements of the Rules been complied with regarding switches, joint boxes, section and distribution boards, protection of cables, method of distribution, lead of cables, lights and fittings *Yes* are all fuses of the filled cartridge type *Yes* are they of an approved type *Yes*

If portable lamps for use in dangerous spaces are supplied, are they of a self-contained, battery-fed type approved by the Home Office *none*

Spare Gear, if the vessel is for open sea service have spares been supplied as per Rule *Yes*

PARTICULARS OF GENERATING PLANT.									
DESCRIPTION OF GENERATOR.	No. of	RATED AT				DRIVEN BY	WHERE DRIVEN BY AN INTERNAL COMBUSTION ENGINE.		
		Kilowatts.	Volts.	Ampères.	Revs. per Min.		Fuel Used.	Flash Point of Fuel.	
MAIN	1	85	110	77	600	Steam engine			
AUXILIARY									
EMERGENCY									
ROTARY TRANSFORMER									

GENERATOR, LIGHTING AND HEATING CONDUCTORS.									
DESCRIPTION.	CONDUCTORS.		COMPOSITION OF STRAND.		TOTAL MAXIMUM CURRENT.		Approximate Length (Lead and Return) Feet.	Insulated with	HOW PROTECTED.
	No. per Pole.	Total Nominal Area per Pole Sq. mm.	No.	Diameter.	Circuit.	Rule.			
MAIN GENERATOR	1	35mm ²	19	1.53	73	78	6 Meters	Fluoride lead covered & armoured	
EQUALISER CONNECTIONS									
AUXILIARY GENERATOR									
EMERGENCY GENERATOR									
ROTARY TRANSFORMER									
ENGINE ROOM	1	10mm ²	7	1.35	14	40	15 Meters	"	"
BOILER ROOM									
AUXILIARY SWITCHBOARDS									
ACCOMMODATION aft. Port	1	10	7	1.35	20	40	20 Meters	"	"
" SB	1	10	7	1.35	15	40	40 Meters	"	"
Midships	1	6	7	1.05	5	30	150 "	"	"
Fore Ship	1	6	7	1.05	10	30	6 "	"	"
Navigation	1	2.5	1	1.70	2	15	60 "	"	"
WIRELESS	1	10	7	1.35	15	40	60 "	"	"
SEARCHLIGHT									
MASTHEAD LIGHT	1	1.5	1	1.30	0.5	10	90 "	"	"
SIDE LIGHTS	1	1.5	1	1.30	0.5	10	90 "	"	"
COMPASS LIGHTS	1	1.5	1	1.30	0.5	10	15 "	"	"
POOP LIGHTS									
CARGO LIGHTS	1	1.5	1	1.30	3	10	40 "	"	"
ARC LAMPS									
HEATERS									

MOTOR CONDUCTORS.										
DESCRIPTION.	No. of Motors.	CONDUCTORS.		COMPOSITION OF STRAND.		TOTAL MAXIMUM CURRENT.		Approximate Length (Lead and Return) Feet.	Insulated with	HOW PROTECTED.
		No. Per Pole.	Total Nominal Area per Pole Sq. Ins.	No.	Diameter.	In Circuit.	Rule.			
BALLAST PUMP										
MAIN BILGE LINE PUMPS										
GENERAL SERVICE PUMP										
EMERGENCY BILGE PUMP										
SANITARY PUMP										
CIRC. SEA WATER PUMPS										
CIRC. FRESH WATER PUMPS										
AIR COMPRESSOR										
FRESH WATER PUMP										
ENGINE TURNING GEAR										
ENGINE REVERSING GEAR										
LUBRICATING OIL PUMPS										
OIL FUEL TRANSFER PUMP										
WINDLASS										
WINCHES, FORWARD										
WINCHES, AFT										
STEERING GEAR—										
(a) MOTOR GENERATOR										
(b) MAIN MOTOR										
WORKSHOP MOTOR	1	1	2.5mm ²	1	1.70mm	13	15	55	Fluoride Armoured	
VENTILATING FANS										

All Conductors are of annealed copper conforming to British Standard Specification No. 7 (or International Electro-technical Commission Publication No. 28).

The Insulated Conductors are guaranteed to withstand the immersion and resistance tests specified in the Rules.

The foregoing is a correct description.

N.V. Groeneveld, Van der Poll & Co's

Electrotechnische Fabriek

Electrical Engineers.

Date

J. M. Millemey

COMPASSES.

Distance between electric generators or motors and standard compass *62 Meters*

Distance between electric generators or motors and steering compass *56 Meters*

The nearest cables to the compasses are as follows:—

A cable carrying *0.1* Ampères *2M* feet from standard compass *2M* feet from steering compass.

A cable carrying Ampères feet from standard compass feet from steering compass.

A cable carrying Ampères feet from standard compass feet from steering compass.

Have the compasses been adjusted with and without the electric installation at work at full power

Has the effect of switching on and off circuits, motors and other electro-magnetic apparatus within the vicinity of the compasses been noted

The maximum deviation due to electric currents was found to be *nil* degrees on course in the case of the standard compass, and *nil* degrees on course in the case of the steering compass.

N.V. NEDERLANDSCHE SCHEEPSBOUW-MAATSCHAPPIJ

Builder's Signature.

Date

Is this installation a duplicate of a previous case *no* If so, state name of vessel *v*

General Remarks (State quality of workmanship, opinions as to class, &c.)

The electric installation has been constructed under special survey to approved plan in accordance with the Society's Rules and Secretary's Letters. Material & workmanship good. Tested installation under full working condition found good.

W. J. J. J.
6/3/35

Total Capacity of Generators *0.5* Kilowatts.

The amount of Fee ... *£102* : When applied for, 19

Travelling Expenses (if any) £ : : *8-3-35* When received, 19 *ND 11/3*

J. J. J. J.
Surveyor to Lloyd's Register of Shipping.

Committee's Minute *TUE. 12 MAR 1935*

Assigned *See Ans. Rpt. 13379*

2m. 534.—Transfer.
The Surveyors are requested not to write on or below the space for Committee's Minute.)



© 2020

Lloyd's Register Foundation