

REPORT ON ELECTRIC LIGHTING INSTALLATION. No. 10380.

Port of MIDDLESBROUGH Date of First Survey Aug Date of Last Survey while building No. of Visits 1
 No. in Reg. Book 42 on the Iron or Steel Screw Steamer PEBBLES Port belonging to White Building
 Built at Stockton By whom Thos Richardson Duck & Co When built 1919
 Owners Sutherland Steamship Co. Owners' Address Newcastle
 Yard No. 675 Electric Light Installation fitted by Thos Clarke Chapman & Co Gateshead When fitted 1919

DESCRIPTION OF DYNAMO, ENGINE, ETC.

One single cylinder double acting open type vertical engine direct coupled to a continuous current compound wound dynamo.

Capacity of Dynamo 100 Amperes at 100 Volts, whether continuous or alternating current continuous

Where is Dynamo fixed in Engine Room Whether single or double wire system is used Double

Position of Main Switch Board near Dynamo having switches to groups A B C D E of lights, &c., as below

Positions of auxiliary switch boards and numbers of switches on each Each light & group of lights provided with switches as required

If fuses are fitted on main switch board to the cables of main circuit Yes and on each auxiliary switch board to the cables of auxiliary circuits Yes and at each position where a cable is branched or reduced in size Yes and to each lamp circuit Yes

If vessel is wired on the double wire system are fuses fitted to both flow and return wires or cables of all circuits including lamp circuits Yes

Are the fuses of non-oxidizable metal Yes and constructed to fuse at an excess of 50% per cent over the normal current

Are all fuses fitted in easily accessible positions Yes Are the fuses of standard dimensions Yes If wire fuses are used are permanent instructions fitted on or near each switch board giving particulars of proper size of fuse for each circuit Yes

Are all switches and fuses constructed of incombustible materials and fitted on incombustible bases Yes slate & porcelain

Total number of lights provided for 138 arranged in the following groups:-

A Accommodation	70 lights each of	16	candle power requiring a total current of	29.2	Amperes
B Engine Room	30 lights each of	16	candle power requiring a total current of	16.8	Amperes
C Navigation	8 lights each of	16	candle power requiring a total current of	4.4	Amperes
D Large Chutes	30 lights each of	16	candle power requiring a total current of	16.8	Amperes
E Winches	- lights each of	-	candle power requiring a total current of	25	Amperes
1	Mast head light with 1 lamp each of	32	candle power requiring a total current of	1.1	Amperes
2	Side light with 1 lamp each of	32	candle power requiring a total current of	2.2	Amperes
5	Cargo lights of	6-16	candle power, whether incandescent or arc lights	incandescent	

If arc lights, what protection is provided against fire, sparks, &c. -

Where are the switches controlling the masthead and side lights placed In Chart Room.

DESCRIPTION OF CABLES.

Main cable carrying 100 Amperes, comprised of 19 wires, each 14 S.W.G. diameter, .094 square inches total sectional area

Branch cables carrying 39.2 Amperes, comprised of 7 wires, each 16 S.W.G. diameter, .022 square inches total sectional area

Branch cables carrying 16.8 Amperes, comprised of 7 wires, each 20 S.W.G. diameter, .0070 square inches total sectional area

Leads to lamps carrying 1.1 Amperes, comprised of 1 wires, each 18 S.W.G. diameter, .0018 square inches total sectional area

Cargo light cables carrying 3.3 Amperes, comprised of 168 wires, each 38 S.W.G. diameter, .0050 square inches total sectional area

DESCRIPTION OF INSULATION, PROTECTION, ETC.


Vulcanized india rubber taped & braided & lead covered where exposed steel armoured overall

Joints in cables, how made, insulated, and protected No joints except mechanical ones

Are all the joints of cables thoroughly soldered, and the flux used not containing acids or other corrosive substances Yes Are all joints in accessible positions, none being made in bunkers, cargo spaces, or spaces which may at any time be used for carrying cargo, stores, or baggage Yes

Are there any joints in or branches from the cable leading from dynamo to main switch board No

How are the cables led through the ship, and how protected Lead covered & steel armoured cables run under deck through holds & clipped up with string galvanised iron clips.

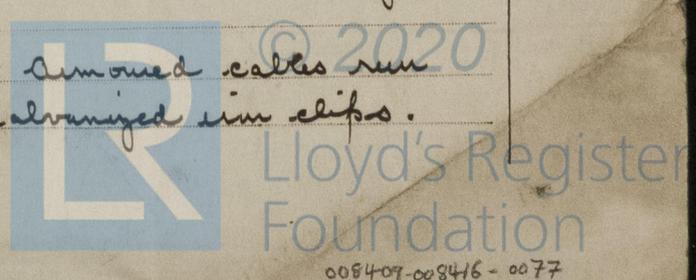

DESCRIPTION OF INSULATION, PROTECTION, ETC.—continued.

Are they in places always accessible no

What special protection has been provided for the cables in open alleyways or where exposed to weather or moisture Lead covered & shielded armoured cables

What special protection has been provided for the cables near galleys or oil lamps or other sources of heat Lead covered & armoured

What special protection has been provided for the cables near boiler casings " " "

What special protection has been provided for the cables in engine room " " "

How are cables carried through beams in lead bushes through bulkheads, &c. in WT glands ✓

How are cables carried through decks in galvanized iron deck lites

Are any cables run through coal bunkers Yes or cargo spaces Yes or spaces which may be used for carrying cargo, stores, or baggage Yes

If so, how are they protected Lead covered & armoured cables

Are any lamps fitted in coal bunkers or spaces which may at times be used for cargo, coals, or baggage no

If so, how are the lamp fittings and cable terminals specially protected

Where are the main switches and fuses for these lights fitted

If in the spaces, how are they specially protected

Are any switches or fuses fitted in bunkers no

Cargo light cables, whether portable or permanently fixed portable How fixed to WT connection boxes

In vessels fitted on the single wire system, how is the dynamo terminal fixed to the hull of vessel Double wire system

How are the returns from the lamps connected to the hull

Are all the joints with the hull in accessible positions

Is the installation supplied with a voltmeter Yes and with an amperemeter Yes, fixed in Luitellound

VESSELS BUILT FOR CARRYING PETROLEUM.

In vessels built for carrying petroleum, are all switches and fuses fitted in positions not liable to the accumulation of petroleum vapour or gas

Are any switches, fuses, or joints of cables fitted in the pump room or companion

How are the lamps specially protected in places liable to the accumulation of vapour or gas

The copper used is guaranteed to have a conductivity of not less than that of the Engineering Standards Committee's standard, and the wires are protected by tinning from the sulphur compounds present in the insulating material.

Insulation of cables is guaranteed to have a resistance of not less than 650 megohms per statute mile at 60° Fahrenheit after 24 hours' immersion in water, the test being made after one minute's electrification at not less than 500 volts and while the cable is still immersed.

The foregoing statements are a correct description of the Electric Light installation fitted by us on this vessel and we declare that it is at this date in good order and safe working condition.

For Clarke, Chapman & Co., Ltd.

Electrical Engineers

Date

May 24 1919

COMPASSES.

Distance between dynamo or electric motors and standard compass 98 ft

Distance between dynamo or electric motors and steering compass 92 ft

The nearest cables to the compasses are as follows:—

A cable carrying	<u>1.1</u>	Amperes	<u>12</u>	feet from standard compass	<u>6</u>	feet from steering compass
A cable carrying	<u>1.1</u>	Amperes	<u>6</u>	feet from standard compass	<u>12</u>	feet from steering compass
A cable carrying	<u>-</u>	Amperes	<u>-</u>	feet from standard compass	<u>-</u>	feet from steering compass

Have the compasses been adjusted with and without the electric installation at work at full power Yes

The maximum deviation due to electric currents, etc., was found to be nil degrees on all courses in the case of the standard compass and nil degrees on all courses in the case of the steering compass.

FOR RICHARDSON, DUCK & CO. LTD.

E. Robson

Builder's Signature.

Date

30 June 1919

GENERAL REMARKS.

Managing Director

This installation has been fitted in accordance with the Rules: is of good materials and workmanship and on completion was examined under full working conditions and found satisfactory

It is submitted that this vessel is eligible for THE RECORD. Elec. light.

Wm Morrison

Surveyor to Lloyd's Register of British and Foreign Shipping.

Committee's Minute

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.

Im. 12.—Transfer.



© 2020

Lloyd's Register Foundation