

REPORT ON ELECTRICAL EQUIPMENT.

(OTHER THAN FOR THE PROPULSION OF THE VESSEL)

23 JUL 1942

Received at London Office.....

Date of writing Report... 25th May 42 When handed in at Local Office... 26th May 42 Port of... MONTREAL, P. Q.

No. in Survey held at... Lauzon, P. Q. Date, First Survey... 5th Jan. Last Survey... 23rd April 19 42
Reg. Book. (Number of Visits... 19.....)on the Steel Single Screw Steamer, "FORT TADOUSSAC" Tons { Gross... 7128.86
Net... 4258.94

Built at... Lauzon, P. Q. By whom built... Davie Shipbldg. & Rpg. Co. Ltd. No. 531. When built... 1942.

Owners... H.M. British Government Port belonging to... -

Electrical Installation fitted by... Davie Shipbuilding & Repairing Co. Ltd. Contract No. 531 When fitted... 1942.

Is vessel fitted for carrying Petroleum in bulk... No Is vessel equipped with D.F. Yes E.S.D. Yes Gy.C. - Sub.Sig. -

Have plans been submitted and approved... Yes System of Distribution... 2 Wire D.C. Voltage of supply for Lighting... 110

Heating... - Power... - Direct or Alternating Current, Lighting... D.C. Power... - If Alternating Current state periodicity... - Prime Movers,

has the governing been tested and found as per Rule when full load is suddenly thrown on and off... Yes Are turbine emergency governors fitted with a

trip switch as per Rule... - Generators, are they compound wound... Yes, are they level compounded under working conditions... Yes,

if not compound wound state distance between generators... - and from switchboard... - Where more than one generator is fitted are they

arranged to run in parallel... No, are shunt field regulators provided... Yes Is the compound winding connected to the negative or positive pole

Negative Have machines over 100 kw. been inspected by the Surveyors during manufacture and testing... - Have certificates of

test for machines under 100 kw. been supplied... Yes and the results found as per rule... Yes Are the lubricating arrangements and the construction

of the generators as per rule... Yes Position of Generators... Both fitted on starb'd side, in engine room.

is the ventilation in way of generators satisfactory... Yes are they clear of inflammable material... Yes, if situated

near unprotected combustible material state distance from same horizontally... - and vertically... - are the generators protected from mechanical

injury and damage from water, steam and oil... Yes, are the bedplates and frames earthed... Yes and the prime movers and generators in metallic

contact... Yes Switchboards, where are main switchboards placed... Starb'd side in engine room.

are they in accessible positions, free from inflammable gases and acid fumes... Yes, are they protected from mechanical injury and damage from water, steam

and oil... Yes, if situated near unprotected combustible material state distance from same horizontally... - and vertically... - what insulation

material is used for the panels... Ebony asbestos 3/4" thick. if of synthetic insulating material is it an Approved Type... - if of

semi-insulating material (slate or marble) are all conducting parts insulated therefrom as per Rule... - Is the frame effectually earthed... Yes

Is the construction as per Rule... Yes, including accessibility of parts... Yes, absence of fuses on the back of the board... None, individual fuses

to pilot and earth lamps, voltmeters, etc... Yes locking of screws and nuts... Yes, labelling of apparatus and fuses... Yes, fuses on the "dead"

side of switches... Yes Description of Main Switchgear for each generator and arrangement of equaliser switches... One 200 amp. quick

break double pole single throw switch.

and for each outgoing circuit... Two 60 amp. and one 30 amp. fused quick break D.P.D.T. switches each board,

for'd board one 200 amp, aft board one 100 amp fused QB. DPDT quick break switches.

Are compartments containing switchboards composed of fire-resisting material or lined as per Rule... - Instruments on main switchboard... 2

ammeters... 2 voltmeters... - synchronising devices. For compound machines in parallel is the ammeter connected on the pole opposite to the

equaliser connection... - Earth Testing, state means provided... Earth lamps

Switches, Circuit Breakers and Fuses, are they as per Rule... Yes, are the fuses an approved type... Yes, are all fuses labelled as

per Rule... Yes If circuit breakers are provided for the generators, at what overload current did they open when tested... - are the reversed current


protection devices connected on the pole opposite to the equaliser connection... - have they been tested under working conditions, and at what current

did they operate... - Joint Boxes, Section Boards and Distribution Boards, is the construction and position as per Rule... Yes

Cables, are they insulated and protected as per the appropriate Tables of the Rules... Yes, if otherwise than as per Rule are they of an approved type... -

state maximum fall of pressure between bus bars and any point under maximum load... - are the ends of all cables having a sectional area of 0.04

square inch and above provided with soldering sockets... Yes Are paper insulated and varnished cambric insulated cables sealed at the ends... None fitted.

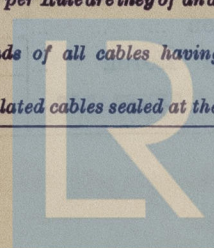

Are all lead sheaths, armouring and conduits effectually bonded and earthed.....Yes..... Refrigerated chambers, are the cables and fittings as per Rule.....Yes.....

Are all cables passing through decks and watertight bulkheads provided with deck tubes or watertight glands.....Yes....., where unarmoured cables pass through beams, etc., are the holes effectively bushed.....Yes..... and with what material.....Lead bushings..... Alternative Lighting, are the groups of lights in the engine and boiler rooms arranged as per Rule.....Yes..... Emergency Supply, state position.....None fitted...... and method of control.....-.....

Navigation Lamps, are they separately wired Yes controlled by separate double pole switches. Yes and fuses Yes. Are the switches and fuses in a position accessible only to the officers on watch. Yes, is an automatic indicator fitted Yes. Secondary Batteries, are they constructed and fitted as per Rule Yes, are they adequately ventilated Yes. what is the battery capacity in ampere hours. only used for Alarm bells, echo sounder and wireless.

are all fittings and accessories constructed and installed as per Rule _____ Searchlight Lamps, No. of _____, whether fixed or portable. _____

installed as per Rule Yes and placed in well-ventilated compartments in which inflammable gases cannot accumulate and free from damage from water, steam and oil Yes, if situated near unprotected combustible material state minimum distance from same horizontally — and vertically —. Are motors coupled to oil fuel transfer and unit pressure pumps capable of being stopped from a position accessible in the event of fire in the pump compartment. —

fitted as per Rule Yes. Lightning Conductors, where required are they fitted as per Rule -. Ships carrying Oil having a Flash Point less than 150° F. Have all the special requirements of the Rules for such ships been complied with 80, are all fuses of the cartridge type ■.

Rule, Yes, are they suitably stored in dry situations -. Insulation Tests, has the insulation resistance of all circuits and apparatus been tested and found satisfactory. Yes.

DESCRIPTION OF GENERATOR.	No. of	RATED AT				DRIVEN BY	WHERE DRIVEN BY AN INTERNAL COMBUSTION ENGINE.	
		Kilowatts.	Volts.	Ampères.	Revs. per Min.		Fuel Used.	Flash Point of Fuel.
MAIN	2	15 each	110	136	575	Vertical steam eng.	-	-
EMERGENCY ...								
ROTARY TRANSFORMER								

DESCRIPTION.	KILOWATTS.	CONDUCTORS.		MAXIMUM CURRENT IN AMPERES.		APPROX. LENGTH (lead plus return feet).	INSULATED WITH.	HOW PROTECTED.
		No. in Parallel Per Pole.	Sectional Area or No. and Dia. of Strands. Sq. ins. or sq. mm.	In the Circuit.	Gauge.			
MAIN GENERATOR	15		000 9strand 15			30	R.C.D.B.	Conduit.
" " EQUALISER								
EMERGENCY GENERATOR	-							
ROTARY TRANSFORMER: MOTOR	-							
" " GENERATOR	-							

DESCRIPTION.	CONDUCTORS.		MAXIMUM CURRENT IN AMPERES.		APPROX. LENGTH (lead plus return feet).	INSULATED WITH.	HOW PROTECTED.
	No. in Parallel Per Pole.	Sectional Area or No. and Dia. of Strands. Sq. ins. or sq. mm.	In the Circuit.				
				Rate.			
AUX. SWITCHBOARDS AND SECTION BOARDS ...							
1 sect. board for'd 4-way.	1	19/083	70	121	280	RCDB	Conduit.
1 " " aft 4-way.	1	7/097	59	76	280	" "	"
Refrigerator 2 H.P. Motor	1	7/038	14	26	240	" "	"
W/T	1	7/097	-	76	120	RCIC	Partly in conduit.
Distribution boxes							
1-6 way Navigation & Bridge lights.	1	7/077	25	57	30	RCDB	Conduit
1-6 way Bridge house lights	1	7/077	18	57	10	" "	"
1-6 way For'd Cargo Lights	1	7/077	14	57	210	" "	"
1-8 way Eng. House lights	1	7/077	23	57	10	" "	"
1-8 way Crews Accommodation	1	7/077	10	57	360	" "	"
1-4 way Amidship Cargo lights	1	7/077	9	57	10	" "	"
1-4 way Aft Cargo Lights	1	7/077	16	57	190	" "	"
1-8 way Eng. & B.R. lights	1	7/077	13	57	50	" "	"

WIRELESS	1	7/077		76	80	RILC
NAVIGATION LIGHTS	1	7/024	4	13	50	RILC
LIGHTING AND HEATING	1	7/024	4	13	4500	RILC

[illegible][illegible]

The Electrical Equipment is installed in accordance with the approved plans and the requirements of the Rules.

All Insulated Conductors are guaranteed to have been tested at the maker's works as specified in the Rules.

The foregoing is a correct description.

DAVIE SHIPBUILDING & REPAIRING COMPANY, Limited,

per Alex. G. Campbell, n.a.

Electrical Engineers.

Date 25th May, 1942.

COMPASSES.

Minimum distance between electric generators or motors and standard compass 73

Minimum distance between electric generators or motors and steering compass 65

The nearest cables to the compasses are as follows:—

A cable carrying 2 Ampères 14'0" feet from standard compass 7'0" feet from steering compass.

A cable carrying 3 Ampères 15'0" feet from standard compass 8'0" feet from steering compass.

A cable carrying 1 Ampères 8'0" feet from standard compass 4'0" feet from steering compass.

Have the compasses been adjusted with and without the electric installation at work at full power No

See attached Cert.

Has the effect of switching on and off circuits, motors and other electro-magnetic apparatus within the vicinity of the compasses been noted No

The maximum deviation due to electric currents was found to be degrees on course in the case of the

standard compass, and degrees on course in the case of the steering compass.

DAVIE SHIPBUILDING & REPAIRING COMPANY, Limited,

Builder's Signature.

Date 25th May, 1942

per Alex. G. Campbell, n.a.

Is this installation a duplicate of a previous case No

If so, state name of vessel

Plans. Are approved plans forwarded herewith Yes

If not, state date of approval

21-8-41.

Certificates. Are certificates of test for motors engaged on essential services and generators forwarded herewith Yes

General Remarks (State quality of workmanship, whether insulation tests, etc., have been made, opinions as to class, etc.)

The electrical equipment of this vessel has been fitted on board under Special Survey and in accordance with the approved plans and tested under full working conditions and found satisfactory.

The materials and workmanship are good and sound.

Noted

31/7/42

Total Capacity of Generators 30 Kilowatts.

The amount of Fee \$ 125.00

When applied for, July 16 42.

Travelling Expenses (if any) £ Exps. Inclusive

When received.

19.

L. Halkett

Surveyor to Lloyd's Register of Shipping.

Committee's Minute

Assigned

See M/L 5644



© 2021

Lloyd's Register Foundation