

SS "WAR RANEE"
NEWCASTLE ON TYNE.

Report No. 71078

NEWCASTLE-on-TYNE,

1918-1918

20th June 1918.

A.R. SNEDDON


the Builders (Messrs. Swan Hunter & Wigham Richardson Ltd.) survey the screw steamer "WAR RANEE" on the 14th June 1918, while lying at the fitting out wharf of that firm's Neptune Shipyard, Walker-on-Tyne, for the purpose of ascertaining the extent of the damage stated to have been sustained by the crane barge "TITAN" colliding with that vessel on the 11th June 1918.

Upon examination found:- One shell plate on the 2nd strake below sheerstrake on port side (No.6 from aft) indented and also one shell plate on the 3rd strake below sheerstrake on port side (No.5 from aft) indented.

Recommended:- Vessel to be placed in dry dock and one shell plate on 2nd strake below sheerstrake on port side (No.6 from aft) and one shell plate on the 3rd strake below sheerstrake on port side (No.5 from aft) to be removed, faired and replaced.

Upon completion of repairs the oil compartments in way of damage to be filled and tested with a head of water 10 ft. above the upper deck, and all disturbed work to be cleaned and coated with paint.

The above recommendations were made so as to place the vessel in the same good condition as she was in before the

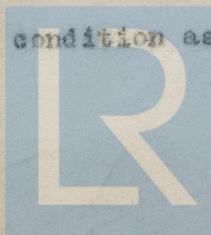

© 2021
Lloyd's Register
Foundation

SS. "WAR RANEE"

damage was sustained.

M. Suedda.

Surveyor to Lloyd's Register.

Fee £2.2.0.



© 2021
Lloyd's Register
Foundation