


Test results for bedplate of D.E. No. 2973:

| Material | test piece marked | dimension of test piece m/m | total load kg | kg pr. ² mm ² | tons pr. ² inch ² | Elongation on 200 m/m mm % | | bend test r=1 1/8" | impact test kgm/cm ² |
|--------------|-------------------------|-----------------------------------|---------------------|---|---|----------------------------------|------|--------------------------|---------------------------------------|
| Differdinger | 2 | 19,7x19,4 | 17490 | 45,8 | 29,1 | 46 | 23 ✓ | r=1 1/8" tapp. | |
| do | 6 | 19,2x19,3 | 17500 | 47,2 | 29,8 | 49 | 24,5 | | |
| do | 7 | 19,6x19,2 | 17180 | 45,7 | 29,0 | 46 | 23 | | |
| do | 2-0 | | | | | | | 180° | 8,5 |
| do | 3 | | | | | | | 180° | 11,9 |
| do | 6-0 | | | | | | | 180° | 8,7 |
| | | | | | | | | | 8,4 |
| | | | | | | | | | 9,2 |
| | | | | | | | | | 12,2 |

↑
Cold or
temp.?

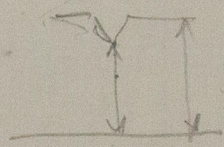

© 2020

Lloyd's Register
Foundation



W175-0242.