

11 JAN 1961


Rpt. 14

Port of CORK.

30th NOVEMBER, 19 60.

## REPORT ON MASTS, SPARS, AND RIGGING

Sirs

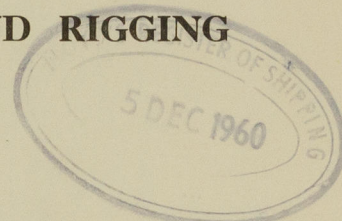

Having, in accordance with your instructions,  
examined the Masts, Spars, Iron Work of same, and Rigging, of the  
(Name of Vessel) S.S. "Cape Drepanon"

on the (Date of examination) 29th OCTOBER 19 60.

I have to report that I found Fore Mast Stays Nos. 2 and 3 Stays  
port and starboard sides and fore top mast stay all in good condition  
Nos. 1 and 4 stays port and starboard and forestay all in way of bottom  
eye purged with rust.

Main Mast Stays port ford stay and port and starboard after stays <sup>AND MAIN STAY</sup>  
renewed. Main back stay purged with rust in way of bottom eye

star ford stay in good condition. Bottle screws regreased on  
new stays

Starboard Sampson Post 3 stays in good condition

Port Sampson Post 3 stays in good condition

Funnel Stays 4 stays renewed. Port and starboard ford stays in  
good condition. Bottle screws on new stays regreased.

Fee £ — : — : —


*Cornelius Murphy*

To the Surveyors,

Lloyd's Register of Shipping,

*Super*

5m.8.56.

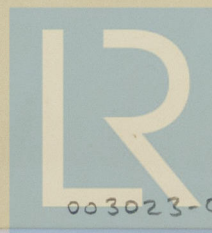

© 2021

Lloyd's Register  
Foundation

003023-003028-0092