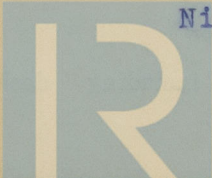


REPORT ON ANNUAL LOAD LINE SURVEY.

Name of Ship S.S. "B U C E G I" Official Number 174217 Port of Registry Aden
Place of Survey Calcutta Dates of Survey 11.8.44. Date of last Load Line Survey 5.6.43.

PARTICULARS OF SURVEY.

Items examined.	Condition in which found.	Repairs.	
		Necessary.	Date effected.
HATCHWAYS, INCLUDING SMALL HATCHWAYS.			
1. Exposed on freeboard deck.			
Coamings, their stays and stiffeners...	Good ✓	Nil	
Beams ...	Good ✓	Nil	
Fore and afters ...	/	/	
*Covers ...	Good ✓	36 hatchboards renewed	11.8.44. ✓
*Tarpaulins (State number per hatchway)	Good (3) ✓	Nil	
*Cleats and battens ...	Good ✓	Nil	
Lashings and their fittings ...	Good ✓	Nil	
Wedges ... (Is supply, including spares, adequate ?)	Good ✓	Supply adequate ✓	
2. Exposed on superstructure decks, including raised quarter decks.			
Coamings, their stays and stiffeners ...	Good ✓	Nil	
Beams ...	Good ✓	Nil	
Fore and afters ...	/	/	
*Covers ...	Good ✓	Nil	
*Tarpaulins (State number per hatchway)	Good (3) ✓	Nil	
*Cleats and battens ...	Good ✓	Nil	
Lashings and their fittings ...	Good ✓	Nil	
Wedges ... (Is supply, including spares, adequate ?)	Good ✓	Supply adequate ✓	
3. Within superstructures not intact or not protected by Class I closing appliances.			
Coamings ...	Good ✓	Nil	
Beams ...	Good ✓	Nil	
Fore and afters ...	/	/	
Covers ...	Good ✓	Nil	
Tarpaulins (State number per hatchway)	Good ✓	Nil	
Cleats and Battens ...	Good ✓	Nil	
Wedges ... (Is supply, including spares, adequate ?)	Good ✓	Nil	

 © 2020
Lloyd's Register

*Tarpaulins, battens, covers, etc., to be examined in place as well as separately (see Board of Trade Circular 1687, paragraph 117 (i)).

Items examined.	Condition in which found.	Repairs.	
		Necessary.	Date effected.
VENTILATORS IN EXPOSED POSITIONS.			
4. To spaces below freeboard deck.			
Coamings, their supports and deck connections	Good ✓	5'-0" Ventilator casings on fiddle casing top efficiently stayed.	11.8.44 ✓
Closing arrangements	Good ✓		
5. To spaces below decks of superstructures which are intact or closed by Class I appliances.			
Coamings, their supports and deck connections	/	/	
Closing arrangements	/	/	
AIR PIPES.			
6. Exposed on freeboard and superstructure decks.			
Closing arrangements	Good ✓	Nil ✓	
7. Within partially enclosed superstructures.			
Closing arrangements	/	/	
MACHINERY CASINGS.			
8. Casing Top.			
Fiddle openings, their covers and fastenings	Good ✓	Nil ✓	
Skylights, their fastenings, covers and lashings	Good ✓	Nil ✓	
9. Exposed on freeboard and raised quarter decks.			
Doors and fastenings	/	/	
10. Exposed on superstructure decks other than raised quarter decks.			
Doors and fastenings	/	/	
11. Within partially enclosed superstructures.			
Doors and fastenings	Good ✓	Nil ✓	
12. FLUSH BUNKER SCUTTLES and chain attachments			
	/	Flush bunker scuttle lids removed & aperature permanently closed by welded plates	11.8.44. ✓
13. COMPANIONWAYS, including deckhouses enclosing ladderways.			
Doors, fastenings, covers	/	/	

Items examined.	Condition in which found.	Repairs.	
		Necessary.	Date effected.
14. CLOSING APPLIANCES FOR OPENINGS IN SUPERSTRUCTURE BULKHEADS.			
Forecastle	Good ✓	New handles fitted ✓	11.8.44. ✓
Bridge, fore end... ..	Good ✓		
Bridge, after end	Good ✓		
Poop	Good ✓		
15. GANGWAY, CARGO AND COALING PORTS.			
In ship's side and superstructures	/	/	
16. SCUPPERS AND SANITARY DISCHARGE PIPES.			
Valves	Good ✓	Nil	
17. SIDE SCUTTLES AND DEADLIGHTS			
	Good ✓	Nil	
18. GUARD RAILS			
	Good ✓	Nil	
19. PROTECTION AND ACCESS TO CREW'S QUARTERS.			
Gangways	Good ✓	Nil	
20. LIFELINES (fittings and material)			
	Good ✓	Nil	
21. FREEING PORTS			
Shutters	Good ✓	Nil	
Protection bars	Good ✓	Nil	
22. TIMBER, TANKER OR SPECIAL STEAMER LOAD LINES.			
Fittings or appliances	/	/	
23. ITEMS NOT INCLUDED IN THE FOREGOING			
	/	/	
24. LOAD LINE MARKS			
	Clear & well cut ✓	Repainted ✓	11.8.44. ✓

Particulars of any change from the conditions given on the Load Line Certificate or on Form C 11.

Certificate A. To be signed by Surveyor in respect of a partial or complete survey.

I have surveyed the ship named at the head hereof, to the extent indicated below, in accordance with the instructions contained in Board of Trade Circular 1687, and the requisite details of the survey have been entered herein.

Index Nos. of items examined. †	Signature of Surveyor.	Place.	Date.
ALL ✓	B. Newton	CALCUTTA	11.8.44.

Certificate B. To be signed by Surveyor completing the survey.

I am satisfied

- (i) that the fittings and appliances for the protection of openings, the guard rails, the freeing ports and the means of access to the crew's quarters have been maintained on the ship in as effective a condition as they were in when the certificate was issued; and
- (ii) that no material alterations have taken place in the hull or superstructures of the ship which affect the positions of the load lines.

I have endorsed the Load Line Certificate and the certified copy as follows:—

Signature of Surveyor B. Newton Place CALCUTTA Date 11.8.44.

Signature B. Newton

Date 11.8.44.


† Insert "all" in case of a complete survey.

137 OCT 1944
X.P.S.

Fee Rs. 60/-

Number of Visits

Surveyors should note that there is only one valid certificate, and the above endorsement should be made thereon. No entry should be made on a certified copy of the certificate unless the original certificate has been produced to and endorsed by the Surveyor.

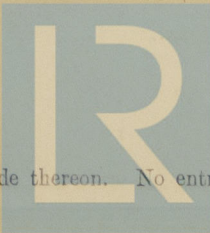

© 2020

Lloyd's Register
Foundation