

Ship's Name SS/MS "ISERNIA"

Gross tons 580

Port of Registry GRIMSBY

Port GRIMSBY

Date of build 1943-2 Is there a Rpt. 9? Yes

Rpt. No. 30983

No. of visits Three

First date 31/8/65

Last date 3/9/65

Interim Cert. issued & copy herewith? Yes

Damage rpt. issued & copy herewith? -

Last rpt. (H.Q. only) - GMS. JOAS2

Date of completing rpt. 10/9/65

Surveyed at, if different from Port above -

Surveyed afloat and/or in D.D. Both

Last date of examination in D.D. 31/8/65

Has a Load Line Survey been held? Not Applicable.

Summer freeboard as verified -

State which additional Rpt. 8 is attached: (Cmt); (PS); (DR); (EO); (Rix)

Survey fees

Damage fee -

Expenses -

Gen: Exam:

£25. 0. 0d.

S.A. fee

I have surveyed the above-named ship in accordance with the Rules for Docking & General Exam:

W.&T. REPAIRS

Fore peak, frames No.3 port and starboard found fractured level with top of floor and all now vee'd out in way of fracture and electric welded.

Four deck beam knee's reriveted.

After peak, for'd pair of deck beam knee's reriveted.

Space under boiler, after collision chock made secure and reriveted in place.

Minor other repairs only required and dealt with.

GENERAL EXAMINATION

Now Done.

All the requirements of circular No.1959 have been dealt with and the items examined are enumerated on Rpt.8(P.S.)

The Owners request for the Special Survey to be postponed until sometime before the end of May 1966, is considered to merit favourable consideration.

The items now surveyed are detailed on this report. All were found or placed in good condition unless otherwise stated. I recommend, therefore, that this ship remain as classed with/without fresh record of dry docking 8,65.

(Where conditions of class are recommended to be retained, imposed, amended or deleted, particulars must be stated above and on the interim certificate.)

Date of Committee

Minute

FRIDAY 22 OCT 1965

G. Beel.

Surveyor to Lloyd's Register of Shipping

FOR CHAIRMAN
CLASSN. CITE

ALSO FOR

SPL FOR

TRO

REPT

SPL

POSTING

HEADER

CERT

Write Gms.
(pp.)

Deferred for SS
S.S. 8.65
MBS. 9.65

(Postponement of SS
until S.66 approved)

004684-004692-0276 h

action taken or recommended should be described fully under "defects & repairs". When any part has been subjected to pressure test this should be stated.

date of the next Special Survey. Where repairs have been effected or it is considered that re-examination or repairs should be made before that date the circumstances and

The condition of any item is to be described as "good" only when it has been examined, found or placed in good condition and is considered to be acceptable until the due

16 SEP 1965

Ship's Name SS/MS "ISERNIA"

S.S. () Due 5,65

Port GRIMSBY

Rpt. No. 30983

<u>Examined & condition</u>		<u>Examined & condition</u>	
In dry dock from	31/8/65	* Air & sounding pipes	Above Dk: Good
" " " to	1/9/65	Doublers under " "	(In part exam'd) - Good
Shell plating	Good	Steering arrangements (main)	Good
Sternframe	Good	" " (aux)	Good
Rudder	Good	Windlass	Good
Was rudder lifted?	No	Masts & rigging	Examined from Dk: - Good
Plating, etc. in way of shell openings	(Inlets) Good	Hand pumps & suction	Good
Side scuttles & deadlights	Good	W.T. doors	On Dk: Good
Overbd. scuppers & discharges	Good	Bulwarks, freeing ports, etc.	Good
F.P. spaces	Good (In part exam'd)	Summer freeboard as verified	-
Chain locker	Good (In part exam'd)		
A.P. spaces	Good (In part exam'd)		
Engine space	Good		
Boiler space	Good	<u>EQUIPMENT:</u>	
Under Ex & B.	Good (In part exam'd)	Equipment letter	j
Coal bunker	-	Fee ltr., if diff. from eqpt. ltr.	1 ⁵ /16"
Tunnel & well	Not examined	Anchors: No. on board	2B & 1K
Cement, asphalt, etc., on btm. shell	Good (In part exam'd)	Cables {	State if ranged No (In part exam'd)
Weather decks	Good		Length on board Stated complete
* Casings	Good		Mean dias. range from - to -
* Deckhouses	Good		Rule length - Dia. -
* Superstructures	Good	Mooring ropes	Sufficient
* Skylights	Good		
* Companionways	Good		
* Hatchways	Good		
* Ventilators	Good		
Other items:	-		

* These items to include their closing appliances


Where a part Special Survey and, say, Dry Docking Survey are held at the same time, the items for SS should be marked "For SS"



© 2020

 Lloyd's Register
 Surveyor to Lloyd's Register of Shipping
 Foundation

HOLDS & 'TWEEN DECKS:	Examined & condition	TANKS:	Examined & condition	Tested & condition
No. 1 Hold		F.P. tank	Good	
„ 'Tween decks		A.P. tank	Good	
		D.B. tanks & c/dams		
No. 2 Hold				
„ 'Tween decks				
No. 3 Hold		O.F. bunkers		
„ 'Tween decks				
		(Settling tanks)		
No. 4 Hold				
„ 'Tween decks		Deep tanks		
No. 5 Hold				
„ 'Tween decks		Side tanks		
No. 6- Hold		Wing tanks		
„ 'Tween decks				
		Other tanks:		
Cargo battens				
Ceiling, etc.				
Fish Room	Good.			

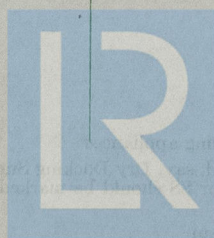

© 2020

Lloyd's Register
Foundation