

F.E.

Chief Ship Surveyor

Received from Chief Ship Surveyor

SHIP'S NAME STEEL S.S. "NAPLES MARU" Rpt. Kobe No. 2587

Remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement." - Extract from Sub-Committee's Report, 24/5/32.)

Transverse No. 79 Depth "d" 16'0"

Plating: Table No. 3 page 14 Description Bulb angle as approved

Longitudinal No. 30415

Proportions Length / Depth = 10.7

Deck Sheerstrake as approved.


This vessel appears to have been built in accordance with the rules and the approved plans, and it is submitted she is eligible to be classed as 100 A.1. (steel) "Awning Deck with freeboard," as recommended. The Summer freeboard of 9'-3 1/2" from centre of disc to top of statutory deck line at Awning deck, now marked on the vessel's sides, to be inserted in the classification certificate, and recorded in the Register Book, and further, the remaining freeboards, shown on the accompanying verification form to be inserted in the certificate of classification.

2 Dks (steel) and Awning Dk (steel)

Cell DB 334 1118t. FPT 126 t. APT 93t.

FR. Collision BH to Awning Dk. 5 BH to Upper Dk. Cem. Lynch A.G.P.

It is concluded, the bottom is cemented but the Surveyor should be requested to state if there is any.

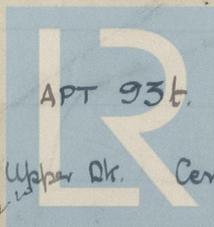

© 2020

Lloyd's Register Foundation

10.10.19

007088-007099-0012