

# REPORT ON ELECTRICAL EQUIPMENT.

(OTHER THAN FOR THE PROPULSION OF THE VESSEL)

Received at London Office... 3 MAY 1945

Date of writing Report... 14<sup>th</sup> APRIL 1945 When handed in at Local Office... 30. 4. 1945 Port of... GLASGOW

No. in Survey held at... PORT GLASGOW Date, First Survey... 30<sup>th</sup> JANUARY Last Survey... 17<sup>th</sup> APRIL 1945 Reg. Book. (Number of Visits... 2)

on the... H.M.T. BIGGAL Tons {Gross... 472 Net... 159

Built at... PORT GLASGOW By whom built... MESSRS FERGUSON BROS (PORT GLASGOW) Yard No... 369 When built... 1945

Owners... ADMIRALTY Port belonging to... -

Electrical Installation fitted by... J. CHARTERS Contract No... 369 When fitted... 1945

Is vessel fitted for carrying Petroleum in bulk... - Is vessel equipped with D.F... YES E.S.D... YES Gy.C... - Sub.Sig... -

Have plans been submitted and approved... YES System of Distribution... TWO WIRE Voltage of supply for Lighting... 110

Heating... 110 Power... 110 Direct or Alternating Current, Lighting... D.C. Power... D.C. If Alternating Current state periodicity... - Prime Movers,

has the governing been tested and found as per Rule when full load is suddenly thrown on and off... YES Are turbine emergency governors fitted with a

trip switch as per Rule... - Generators, are they compound wound... YES, are they level compounded under working conditions...

if not compound wound state distance between generators... - and from switchboard... - Where more than one generator is fitted are they

arranged to run in parallel... NO, are shunt field regulators provided... YES Is the compound winding connected to the negative or positive pole

POSITIVE Have machines over 100 kw. been inspected by the Surveyors during manufacture and testing... - Have certificates of

test for machines under 100 kw. been supplied... - and the results found as per rule... - Are the lubricating arrangements and the construction

of the generators as per rule... YES Position of Generators... IN ENGINE ROOM

is the ventilation in way of generators satisfactory... YES are they clear of inflammable material... YES, if situated

near unprotected combustible material state distance from same horizontally... - and vertically... - are the generators protected from mechanical

injury and damage from water, steam and oil... YES, are the bedplates and frames earthed... YES and the prime movers and generators in metallic

contact... YES Switchboards, where are main switchboards placed... NEAR GENERATORS

are they in accessible positions, free from inflammable gases and acid fumes... YES, are they protected from mechanical injury and damage from water, steam

and oil... YES, if situated near unprotected combustible material state distance from same horizontally... - and vertically... - what insulation

material is used for the panels... MICANISED BARS, if of synthetic insulating material is it an Approved Type... YES, if of

semi-insulating material (slate or marble) are all conducting parts insulated therefrom as per Rule... - Is the frame effectually earthed... YES

Is the construction as per Rule... YES, including accessibility of parts... YES, absence of fuses on the back of the board... YES, individual fuses

to pilot and earth lamps, voltmeters, etc... YES locking of screws and nuts... YES, labelling of apparatus and fuses... YES, fuses on the "dead"

side of switches... YES Description of Main Switchgear for each generator and arrangement of equaliser switches...

D.P. KNIFE PATTERN SWITCH AND FUSES

and for each outgoing circuit... D.P. CHANGE-OVER KNIFE PATTERN SWITCH AND FUSES

Are compartments containing switchboards composed of fire-resisting material or lined as per Rule... - Instruments on main switchboard... 2

ammeters... 2 voltmeters... - synchronising devices. For compound machines in parallel is the ammeter connected on the pole opposite to the

equaliser connection... - Earth Testing, state means provided... EARTH LAMPS

Switches, Circuit Breakers and Fuses, are they as per Rule... ADM. PATT are the fuses an approved type... ADM. PATT, are all fuses labelled as

per Rule... YES If circuit breakers are provided for the generators, at what overload current did they open when tested... - are the reversed current


protection devices connected on the pole opposite to the equaliser connection... - have they been tested under working conditions, and at what current

did they operate... - Joint Boxes, Section Boards and Distribution Boards, is the construction and position as per Rule... ADM. PATT

Cables, are they insulated and protected as per the appropriate Tables of the Rules... YES, if otherwise than as per Rule are they of an approved type... W.E.,

state maximum fall of pressure between bus bars and any point under maximum load... 4.35 lbs are the ends of all cables having a sectional area of 0.04

square inch and above provided with soldering sockets... YES Are paper insulated and varnished cambric insulated cables sealed at the ends... YES

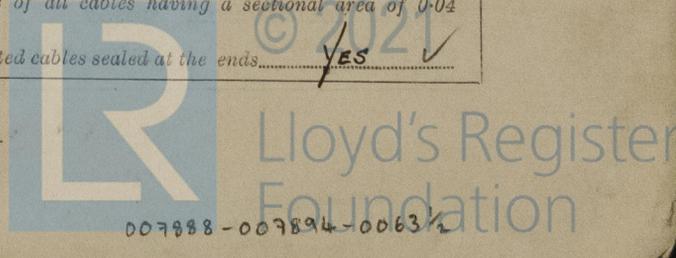



The Electrical Equipment is installed in accordance with the approved plans and the requirements of the Rules.  
 All Insulated Conductors are guaranteed to have been tested at the maker's works as specified in the Rules.  
 The foregoing is a correct description.

*J. Hartley / J. H. C.*

Electrical Engineers.

Date *20/04/45*

COMPASSES.

Minimum distance between electric generators or motors and standard compass..... *16 FEET*

Minimum distance between electric generators or motors and steering compass..... *12 FEET*

The nearest cables to the compasses are as follows:—

A cable carrying *17* Ampères *12* feet from standard compass *8* feet from steering compass.

A cable carrying *18* Ampères *LED. T.M.T.* feet from standard compass *LED. T.M.T.* feet from steering compass.

A cable carrying ..... Ampères ..... feet from standard compass ..... feet from steering compass.

Have the compasses been adjusted with and without the electric installation at work at full power ..... *YES*

Has the effect of switching on and off circuits, motors and other electro-magnetic apparatus within the vicinity of the compasses been noted ..... *YES*

The maximum deviation due to electric currents was found to be *Nil* degrees on *Ray* course in the case of the standard compass, and *Nil* degrees on *Ray* course in the case of the steering compass.

ERGLISON BROTHERS (PORT-GLASGOW) LTD.

*R. Ferguson*

DIRECTOR

Builder's Signature.

Date *21/4/45*

Is this installation a duplicate of a previous case..... *YES* If so, state name of vessel *H.M.S. MINCHARD*

Plans. Are approved plans forwarded herewith..... If not, state date of approval.....

Certificates. Are certificates of test for motors engaged on essential services and generators forwarded herewith.....

General Remarks (State quality of workmanship, whether insulation tests, etc., have been made, opinions as to class, etc.).....

*The electrical equipment of this vessel has been fitted on board under special survey in accordance with the Admiralty plans and specifications, tested under full working conditions and found satisfactory. The materials and workmanship are good.*

Notes

*Run*

*10.5.45*

Total Capacity of Generators..... *27 1/2* Kilowatts.

The amount of Fee ... .. £ *21 : 5 :*

SPECIFICATION £ *21 : 5 :*

Travelling Expenses (if any) £ *- : - :*

When applied for,

*at Gk*

When received,

.....19.....

ADMIRALTY  
 A/c rendered from  
 London *29.6.45*

*J. M. Gardiner*  
 Surveyor to Lloyd's Register of Shipping.

Committee's Minute

**GLASGOW**

**1 MAY 1945**

**SEE ACCOMPANYING MACHINERY REPORT.**

Assigned.....

Form 439—Transfer. (MADE AND PRINTED IN ENGLAND.)  
 (The Surveyors are requested not to write on or below the space for Committee's Minutes.)



© 2021

Lloyd's Register Foundation