

CARDIFF *Freeboard Annual No. 1965*
LLOYD'S REGISTER OF SHIPPING
UNITED WITH THE BRITISH CORPORATION REGISTER

28 MAY 1953

REPORT ON ANNUAL LOAD LINE SURVEY.

Name of Ship "ARGENTINE TRANSPORT" Official Number 169847 Port of Registry London
Place of Survey Avonmouth Dates of Survey 29.4.53 Date of last Load Line Survey 14.12.51
Newport. 1st. & 6th. May 1953.

PARTICULARS OF SURVEY.

Items examined.	Condition in which found.	Repairs.	
		Necessary.	Date effected.
HATCHWAYS, INCLUDING SMALL HATCHWAYS.			
1. Exposed on freeboard deck.			
Coamings, their stays and stiffeners	Good ✓		
Beams	Good		
Fore and afters	- -		
*Covers	Good except	23 slab hatches to renew	6/5/53.
*Tarpaulins	Good (3) ✓	13 slab hatches to repair	6/5/53.
(State number per hatchway)	Good		
*Cleats and battens	Good		
Lashings and their fittings	Good ✓		
Wedges	Good (Yes)		
(Is supply, including spares, adequate ?)			
2. Exposed on superstructure decks, including raised quarter decks.			
Coamings, their stays and stiffeners	- -		
Beams	- -		
Fore and afters	- -		
*Covers	- -		
*Tarpaulins	- -		
(State number per hatchway)	- -		
*Cleats and battens	- -		
Lashings and their fittings	- -		
Wedges	- -		
(Is supply, including spares, adequate ?)			
3. Within superstructures not intact or not protected by Class I closing appliances.			
Coamings	- -		
Beams	- -		
Fore and afters	- -		
Covers	- -		
Tarpaulins	- -		
(State number per hatchway)	- -		
Cleats and Battens	- -		
Wedges	- -		
(Is supply, including spares, adequate ?)			
VENTILATORS IN EXPOSED POSITIONS.			
4. To spaces below freeboard deck.			
Coamings, their supports and deck connections	Good ✓		
Closing arrangements	Good		
5. To spaces below decks of superstructure which are intact or closed by Class I appliances.			
Coamings, their supports and deck connections	Good ✓		
Closing arrangements	Good		
AIR PIPES.			
6. Exposed on freeboard and superstructure decks.			
Closing arrangements	Good ✓		
7. Within partially enclosed superstructures.			
Closing arrangements	- -		
MACHINERY CASINGS.			
8. Casing Top.			
Fiddle openings, their covers and fastenings	- -		
Skylights, their fastenings, covers and lashings	Good ✓		
9. Exposed on freeboard and raised quarter decks.			
Doors and fastenings	- -		
10. Exposed on superstructure decks other than raised quarter decks.			
Doors and fastenings	Good except ✓	1 escape door to repair (p.s.) 1 escape door to repair (s.s.)	6/5/53. 6/5/53.
11. Within partially enclosed superstructures.			
Doors and fastenings	Good except ✓	E.R. door lock to repair	6/5/53.
12. FLUSH BUNKER SCUTTLES and chain attachments			
	- -		
13. COMPANIONWAYS, including deckhouses enclosing ladderways.			
Doors, fastenings, covers	Good except ✓	Ford. magazine door to repair Amidships accom. doors to repair After masthouse doors to repair	6/5/53. 6/5/53. 6/5/53.

* Tarpaulins, battens, covers, etc., to be examined in place as well as separately (see Ministry of Transport Circular 1687, paragraph 117 (i)).

Items examined.	Condition in which found.	Repairs.	
		Necessary.	Date effected.
14. CLOSING APPLIANCES FOR OPENINGS IN SUPER-STRUCTURE BULKHEADS.			
Forecastle	--		
Bridge, fore end	--		
Bridge, after end	--		
Poop	--		
15. GANGWAY, CARGO AND COALING PORTS.			
In ship's side and superstructures	--		
16. SCUPPERS AND SANITARY DISCHARGE PIPES.			
Valves	Good ✓		
17. SIDE SCUTTLES AND DEADLIGHTS	Good ✓		
18. GUARD RAILS	Good ✓		
19. PROTECTION AND ACCESS TO CREW'S QUARTERS.			
Gangways	--		
20. LIFELINES (fittings and material)	Good ✓		
21. FREEING PORTS.			
Shutters	--		
Protection bars	--		
22. TIMBER, TANKER OR SPECIAL STEAMER LOAD LINES.			
Fittings or appliances	--		
23. ITEMS NOT INCLUDED IN THE FOREGOING.			
	--		
24. LOAD LINE MARKS	Verified. (Newport). <i>W.L.</i> Not verified		1/5/53.

Certificate A. To be signed by Surveyor in respect of a partial or complete survey.

I have surveyed the ship named at the head hereof, to the extent indicated below, in accordance with the instructions contained in Ministry of Transport Circular 1687, and the requisite details of the survey have been entered herein.

Index Nos. of items examined.† († Insert "all" in case of a complete survey.)	Signature of Surveyor.	Place.	Date.
All except No. 24	<i>Shwren.</i>	Avonmouth	29th April, 1953.
Item 24.	<i>W. Lind</i>	Newport. Mon.	1st. May 1953.

Certificate B. To be signed by Surveyor completing the survey.

I am satisfied

- (i) that the fittings and appliances for the protection of openings, the guard rails, the freeing ports and the means of access to the crew's quarters have been maintained on the ship in as effective a condition as they were in when the certificate was issued; and
- (ii) that no material alterations have taken place in the hull or superstructures of the ship which affect the positions of the load lines.

I have endorsed the Load Line Certificate and the certified copy as follows:—

Signature of Surveyor *W. Lind* Place *Newport Mon.* Date *6th May 1953.*


Signature *Shwren. W. Lind*

Date *4th May 1953.*

Fee Bristol £13. 0. 0.
Exps. 6. 0.
Cardiff. 2 9. 10.0. Exps. 6/9d.
Number of Visits Bristol - 1
Cardiff - 2

Particulars of any change from the conditions given on the Load Line Certificate or on Form C 11 should be reported on Form C 11 (contd.) and attached to the Form C 11 on the Ship, a copy being forwarded to the Freeboard Department.

Surveyors should note that there is only one valid certificate, and the above endorsement should be made thereon. No entry should be made on a certified copy of the certificate unless the original certificate has been produced to and endorsed by the Surveyor.

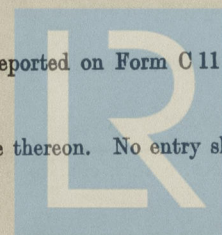

© 2020

Lloyd's Register
Foundation