

COPY

Lloyd's Register of Shipping.

Port of Kobe.

14th March, 1928.

This is to Certify that

H. D. Buchanan.

The undersigned Surveyor to this Society did at the request of the Master and Owners' Agents, survey the repairs to the S/S "CERRO GARDO" 2347 tons gross of San Francisco, executed at Mitsubishi Dockyard, Kobe.

All repairs have now been satisfactorily completed as recommended in Kobe damage report dated March 10th 1928, and a detail of the internal damage repairs to No.1 double bottom tank and/or additional damage not mentioned in damage report has been completed as follows:-

Four (4) floors buckled
(2 Port & 2 Starboard).

have been removed, faired and refitted.

Two (2) floors buckled
(1 Port & 1 Starboard).

Port side floor has been faired in place & Starboard side has been cropped part removed, faired & refitted with butt straps.

Centre girder & shell angles buckled for a length of three frame spaces.

has been faired in place.


H. D. Buchanan.

SURVEYOR TO LLOYD'S REGISTER.

Fee.....Yen 60:00
Expenses...Yen 10:00
Yen 70:00

© 2021

ate is issued upon the terms of the Rules and Regulations of the Society, which provide that:-
Committee use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that
tee nor the Society are under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate
y or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default,
e Surveyors, or other Officers or Agents of the Society."

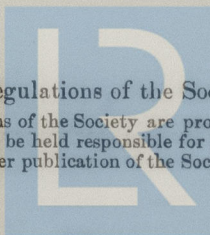

Foundation

009647-009654-0263.3