

29 NOV 1944

# THE BRITISH CORPORATION FOR THE SURVEY AND REGISTRY OF SHIPPING.

## REPORT ON HULL, &c.

No. of Report, ..... Port of Barcelona  
28th October 1944.  
 Co. in Reg. Book, 9 Gross Tonnage, 4017  
Bottom Survey held\* in lifting floating dock on the  
 steel S/S "Ramon Alonso R" Master, Jose Gambús Year of Cert., 1932  
 Built by A. Mc. Millan & Co. Ltd. When 4/898 Port of Registry Barcelona  
 Owners, Emp. de Ramon A. Ramos Intended Voyage, to Terranova.  
 Classed B.S. Last Survey, S.S. No. 3 on 9/43 Bilbao.  
 6th Special Survey, No. 1 due 9/47 B.T. Cert. expires .....

\* Insert name of Dry Dock; or where, if afloat.

If repairs are carried out, distinguish clearly between those consequent upon damage, and those due to wear and tear.

This Vessel placed in the Floating Dock of Barcelona;  
 after cleaned bottom, flat keel, and rudder (no lifted)  
 examined and found good propeller and out side  
 lashings. - Valves and sea water connections opened  
 out and found or placed in order.  
 Repairs: Stake J. No. 5 plate from aft (on starb.) renewed.  
 No. 2 stinger plate, on port side fore, doubled.  
 Steering gear, together with all parts of transmissions gear,  
 blocks, rods, chains etc., examined opened out. - One  
 block and rod renewed, and steering chains annealed.  
 Tree-board verified: No alterations.

[OVER.]

st Visit, 17/10/44. Last Visit, 28/10/44 Vessel then in good condition.

o. of Visits, four.

s, £150. 540-

Advised, .....

penses, .....


Paid, .....

£150. 540-

Chief Surveyor.

Manuel Luna

Surveyor to the British Corporation for the Survey  
and Registry of Shipping.

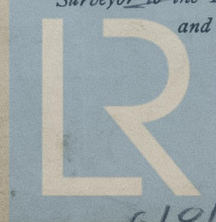

Lloyd's Register

610179-010188-0244

010179-010188-0150