

Rpt. C 11 (a).

# LLOYD'S REGISTER OF SHIPPING

UNITED WITH THE BRITISH CORPORATION REGISTER

11 MAY 1960


## REPORT ON ANNUAL LOAD LINE SURVEY

Name of Ship "SULFACRETE" Official Number 183081 Port of Registry LONDON  
 Place of Survey SUNDERLAND Dates of Survey 4th, 19th & 21st April, 1960. Date of issue of Cert. of Load Line Survey 30. 1. 59.

### PARTICULARS OF SURVEY

| Items examined.   | Condition in which found. | Repairs.   |                          |
|---|---------------------------|--|--------------------------|
|   |                           | Necessary.   | Date effected.           |
| <b>HATCHWAYS, INCLUDING SMALL HATCHWAYS.</b>  |                           |  |                          |
| <b>1. Exposed on freeboard deck.</b>  |                           |  |                          |
| Coamings, their stays and stiffeners ... ..   | Good                      |  |                          |
| Beams ... ..  | -                         |  |                          |
| Fore and afters ... ..  | -                         |  |                          |
| *Covers Steel W.T. ... ..   | Good, except              | a few sections to overhaul.  | 21. 4. 60.               |
| *Tarpaulins ... ..<br>(State number per hatchway)   | -                         |  |                          |
| *Cleats and battens Sides & Ends ... ..   | Good, except              | a few to overhaul.   | 21. 4. 60.               |
| Lashings and their fittings ... ..  | -                         |  |                          |
| Wedges Cross Joint ... ..<br>(Is supply, including spares, adequate?)                               | Good, except              | a few to replace.  | 21. 4. 60.               |
| <b>2. Exposed on superstructure decks, including raised quarter decks.</b>                          |                           |  |                          |
| Coamings, their stays and stiffeners ... ..   | Good                      |  |                          |
| Beams ... ..  | -                         |  |                          |
| Fore and afters ... ..  | -                         |  |                          |
| *Covers Steel W.T. & Wood ... ..  | Good, except              | 2 end bands to refit on bunker hatch and jointing on steel covers to overhaul. | 21. 4. 60.               |
| *Tarpaulins ... ..<br>(State number per hatchway)   | Good<br>(2)               |  |                          |
| *Cleats and battens ... ..  | Good                      |  |                          |
| Lashings and their fittings ... ..  | -                         |  |                          |
| Wedges ... ..<br>(Is supply, including spares, adequate?)   | Good<br>(Yes)             |  |                          |
| <b>3. Within superstructures not intact or not protected by Class I closing appliances.</b>         |                           |  |                          |
| Coamings ... ..   |                           |  |                          |
| Beams ... ..  |                           |  |                          |
| Fore and afters ... ..  |                           |  |                          |
| Covers ... ..   |                           |  |                          |
| Tarpaulins ... ..<br>(State number per hatchway)  |                           |  |                          |
| Cleats and Battens ... ..   |                           |  |                          |
| Wedges ... ..<br>(Is supply, including spares, adequate?)   |                           |  |                          |
| <b>VENTILATORS IN EXPOSED POSITIONS.</b>  |                           |  |                          |
| <b>4. To spaces below freeboard deck.</b>   |                           |  |                          |
| Coamings, their supports and deck connections ... ..  | Good                      |  |                          |
| Closing arrangements ... ..   | Good                      |  |                          |
| <b>5. To spaces below decks of superstructure which are intact or closed by Class I appliances.</b> |                           |  |                          |
| Coamings, their supports and deck connections ... ..  | Good                      |  |                          |
| Closing arrangements ... ..   | Good, except              | several mushroom vents to overhaul.  | 19. 4. 60.               |
| <b>AIR PIPES.</b>   |                           |  |                          |
| <b>6. Exposed on freeboard and superstructure decks.</b>  |                           |  |                          |
| Closing arrangements ... ..   | Good, except              | 4 air pipes to renew.<br>2 wood plugs to supply.                               | 19. 4. 60.<br>19. 4. 60. |
| <b>7. Within partially enclosed superstructures.</b>  |                           |  |                          |
| Closing arrangements ... ..   | -                         |  |                          |
| <b>MACHINERY CASINGS.</b>   |                           |  |                          |
| <b>8. Casing Top.</b>   |                           |  |                          |
| Fiddle openings, their covers and fastenings ... ..   | Good, except              | securing clips for covers to repair.   | 19. 4. 60.               |
| Skylights, their fastenings, covers and lashings ... ..   | Good, except              | quadrant pins & chains to refit.   | 19. 4. 60.               |
| <b>9. Exposed on freeboard and raised quarter decks.</b>  |                           |  |                          |
| Doors and fastenings ... ..   | Good, except              | toggles to overhaul.   | 19. 4. 60.               |
| <b>10. Exposed on superstructure decks other than raised quarter decks.</b>                         |                           |  |                          |
| Doors and fastenings ... ..   | -                         |  |                          |
| <b>11. Within partially enclosed superstructures.</b>   |                           |  |                          |
| Doors and fastenings ... ..   | Good                      |  |                          |
| <b>12. FLUSH BUNKER SCUTTLES and chain attachments</b>  |                           |  |                          |
| <b>13. COMPANIONWAYS, including deckhouses enclosing ladders.</b>                                   |                           |  |                          |
| Doors, fastenings, covers ... ..  | Good, except              | 1 door lock to renew & door toggles to overhaul.                               | 19. 4. 60.               |

\* Tarpaulins, battens, covers, etc., to be examined in place as well as separately (see Ministry of Transport Circular 1687, paragraph 117 (i)).

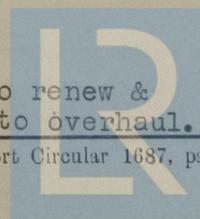

© 2021

Lloyd's Register Foundation

011304-011315-0046

| Items examined.  | Condition in which found. | Repairs.  |                |
|--|---------------------------|---|----------------|
|  |                           | Necessary.                                      | Date effected. |
| <b>14. CLOSING APPLIANCES FOR OPENINGS IN SUPER-STRUCTURE BULKHEADS.</b> |                           |   |                |
| Forecastle ... ..  | Good                      |   |                |
| Bridge fore end R. Q. D. ... ..  | No openings               |   |                |
| Bridge, after end ... ..   | -                         |   |                |
| Poop ... .. <i>on R. Q. D.</i>   |                           |   |                |
| <b>15. GANGWAY, CARGO AND COALING PORTS.</b>                             |                           |   |                |
| In ship's side and superstructures ... ..                                | -                         |   |                |
| <b>16. SCUPPERS AND SANITARY DISCHARGE PIPES.</b>                        |                           |   |                |
| Valves ... ..  | Good                      |   |                |
| <b>17. SIDE SCUTTLES AND DEADLIGHTS</b> ... ..                           | Good, except              | a few to overhaul.                              | 21. 4. 60.     |
| <b>18. GUARD RAILS &amp; Bulwarks</b> ... ..                             | Good, except              | pins & chains to fit at portable rail sections. | 21. 4. 60.     |
| <b>19. PROTECTION AND ACCESS TO CREW'S QUARTERS.</b>                     |                           |   |                |
| Gangways ... ..  | -                         |   |                |
| <b>20. LIFELINES (fittings and material)</b> ... ..                      |                           |   |                |
| Valves ... ..  | Good                      |   |                |
| <b>21. FREEING PORTS. Slots</b>  |                           |   |                |
| Shutters ... ..  | Good                      |   |                |
| Protection bars ... ..   | -                         |   |                |
| <b>22. TIMBER, TANKER OR SPECIAL STEAMER LOAD LINES.</b>                 |                           |   |                |
| Fittings or appliances ... ..  | -                         |   |                |
| <b>23. ITEMS NOT INCLUDED IN THE FOREGOING.</b>                          |                           |   |                |
|  | -                         |   |                |
|  | -                         |   |                |
|  | -                         |   |                |
| <b>24. LOAD LINE MARKS</b> ... ..  | Verified                  |   |                |

**Certificate A. To be signed by Surveyor in respect of a partial or complete survey.**

I have surveyed the ship named at the head hereof, to the extent indicated below, in accordance with the instructions contained in Ministry of Transport Circular 1687, and the requisite details of the survey have been entered herein.

| Index Nos. of items examined.†<br>(† Insert "all" in case of a complete survey.) | Signature of Surveyor. | Place.     | Date.             |
|--|------------------------|------------|-------------------|
| ALL  |                        | SUNDERLAND | 21ST APRIL, 1960. |

**Certificate B. To be signed by Surveyor completing the survey.**

I am satisfied

- (i) that the fittings and appliances for the protection of openings, the guard rails, the freeing ports and the means of access to the crew's quarters have been maintained on the ship in as effective a condition as they were in when the certificate was issued; and
- (ii) that no material alterations have taken place in the hull or superstructures of the ship which affect the positions of the load lines.

I have endorsed the Load Line Certificate and the certified copy as follows:—

Signature of Surveyor  Place Sunderland Date 21st April 1960.

Signature  JOHN R. WRIGHT.  
Date 6th May 1960.

Fee £17. 0. 0.

Number of Visits 3

Particulars of any change from the conditions given on the Load Line Certificate or on Form C 11 should be reported on Form C 11 (contd.) and attached to the Form C 11 on the Ship, a copy being forwarded to the Freeboard Department.

Surveyors should note that there is only one valid certificate, and the above endorsement should be made thereon. No entry should be made on a certified copy of the certificate unless the original certificate has been produced to and endorsed by the Surveyor.

