

COPY

18 FEB 1949

Rpt. C. 11 (Contd.)

Index No.

Lloyd's Register of Shipping. 2735

Ship's Name S.S. "MANGOLA" Official No. 137223

Memorandum of alterations reported since ship was surveyed for assignment of Load Lines in

OPENING SHELTER DECK:

The tonnage opening in the shelter deck has now been restored and fitted with efficient temporary covers. ✓

Scuppers draining the shelter tween deck spaces by scupper pipes led to hold bilges now fitted with screw down valves controlled from shelter deck fitted with indicators showing open and closed positions. ✓

Scupper pipes draining shelter tween deck to Machinery spaces bilges now fitted with self closing cocks in accessible positions at their lower ends. ✓

Freeing ports, and overboard scuppers in tonnage well, now restored. ✓

All hatchways on second deck, coamings, covers, supports, bearing surfaces, tarpaulins, cleats and battening arrangement in accordance with the Rules. ✓

Openings in machinery casings in shelter tween decks, as originally fitted. ✓

The freeboard marks assigned as an open shelter deck vessel have been correctly cut in, painted, and have been verified. ✓

ADDITIONAL HATCHES

Access hatches have now been fitted on the starboard sides of shelter and second decks between Nos. 1 & 2 and between Nos. 3 & 4 main hatches.

Those on shelter deck are 3'-0" x 2'-6" coamings 2'-6" high by $\frac{1}{2}$ " thick fitted with $2\frac{1}{2}$ " wood covers, $2\frac{1}{2}$ " bearing surface, cleats, battens and tarpaulins in accordance with the Rules. ✓Those on 2nd deck are 3'-0" x 2'-6" coamings 9" high x $\frac{7}{16}$ " fitted with $2\frac{1}{2}$ " wood covers $2\frac{1}{2}$ " bearing, surfaces, cleats, battens and tarpaulins in accordance with the Rules. ✓

A. M. B. M. M.

SURVEYOR TO LLOYD'S REGISTER.


SYDNEY. N.S.W.

17th December, 1948.

Holid f

21 FEB 1949

Fee £10-0-0

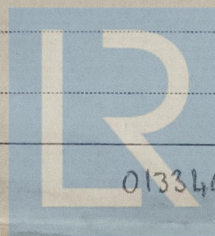

© 2021

Lloyd's Register
Foundation

013346-013355-0316