

(Translation).

LLOYD'S REGISTER OF SHIPPING.

Results of Tests of Steel.

carried out by the Surveyor to Lloyd's Register, at
St. Etienne, for Sociedad Espanola de Construcción Naval, Bilbao.

Order No. 2025 dated 23rd May 1932. Cert. No. 5.

Results of tests of 4 400 litre receivers, according to
plan C.U. 2299 and of 4 150 litre receivers, according to
plan 2300. Makers : Ets. Brunon & Valette, Rive de Gier (Loire).

19/7
20/7
30/8
31/8

400 litre receivers

200 mm bar
L : $\sqrt{V} 66,67 \text{ S}$

No. 1 across, 30.5 x 8.9 x 135 S: 61.5 E: 22.9 %
No. 2 bending, ring 40 mm high, satisfactory.
No. 3 across, 30.7 x 10.7 x 148 S: 62.7 E: 20.2 %
No. 4 bending, ring 40 mm. high, satisfactory.
THESE TESTS HAVE BEEN SATISFACTORY.

RESULTS OF PRESSURE, WEIGHT & CAPACITY TESTS.

	Exerted pressure	Weight empty	Capacity
No. 1	140 Kgs.	515 Kgs.	413 litres
No. 2	140 "	515 "	415 "
No. 3	140 "	535 "	409 "
No. 4	140 "	529 "	411 "

THESE TESTS HAVE BEEN SATISFACTORY.

150 litre receivers.

R

(I)
LLOYD'S
No. 5
31.8.32.

No. 5 across, 29.3 x 8.7 x 130 S: 60.4 E: 22.3 %
No. 6 bending, ring 40 mm high, satisfactory.
No. 7 across, 30.6 x 9.5 x 139 S: 63.2 E: 18.7 %
No. 8 bending, ring 40 mm high, satisfactory.
THESE TESTS HAVE BEEN SATISFACTORY.

RESULTS OF PRESSURE, WEIGHT & CAPACITY TESTS.

	Exerted pressure	Weight empty	Capacity
No. 5	140 Kgs.	259 Kgs.	155 litres
No. 6	140 "	254 "	153 "
No. 7	140 "	269 "	152 "
No. 8	140 "	271 "	154 "

THESE TESTS HAVE BEEN SATISFACTORY.

Flange attached to receivers, cast steel, S: 53 Kgs. E: 20 %.


Tests satisfactory.

All these tests have been carried out at the works of
Messrs. Ets. BRUNON & VALETTE, Rive-de-Gier (Loire).

These receivers have been tested and surveyed as per plans
C.U. 2299 and C.U. 2300, and bear the mark (I) on the pointed part
of each receiver, beside the maker's name.

Signature

Surveyor to Lloyd's Register.

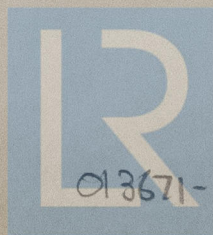

© 2021

Lloyd's Register
Foundation

013671-013677-0002