



# THE STEEL COMPANY OF SCOTLAND, LIMITED.

Test Room Sheet *Newton* Works, the *23<sup>rd</sup>* day of *October* 18*94*

ORDER No.	QUALITY.	CHARGE No.	SAMPLE No.	SIZE OF SAMPLE.			BREAKING STRAIN.		EXTENSION.			CONDITION.		INITIAL STRAIN.		SIZE OF FRACTURE.				REMARKS.	
				Bth.	Thk.	Area.	Actual Tons.	Per @/ Tons.	% Ins.	% Ins.	% Ins.	Long or Cross.	Annealed or Unannealed.	Actual Tons.	Per @/ Tons.	Bth.	Thk.	Area.	%		
<i>Stern frame (two pieces) for Messrs Workman Clark &amp; Co. N<sup>o</sup> 94</i>																					
<i>Upper part</i>				<i>.96</i>	<i>dia.</i>	<i>.723</i>	<i>20.8</i>	<i>28.7</i>	<i>14.0</i>	<i>Bent to 95° without fracture</i>											<i>} 23/10/94</i>
<i>Lower part</i>				<i>.90</i>	<i>dia.</i>	<i>.636</i>	<i>19.0</i>	<i>29.8</i>	<i>12.0</i>	<i>" " 93° "</i>											
																					
<i>Upper part</i>																					
<i>Hammered with good results 22/10/94</i>																					
<i>Lower part</i>																					
<i>Dropped and hammered with good results 10/10/94</i>																					
<i>Charles Cropper</i>																					

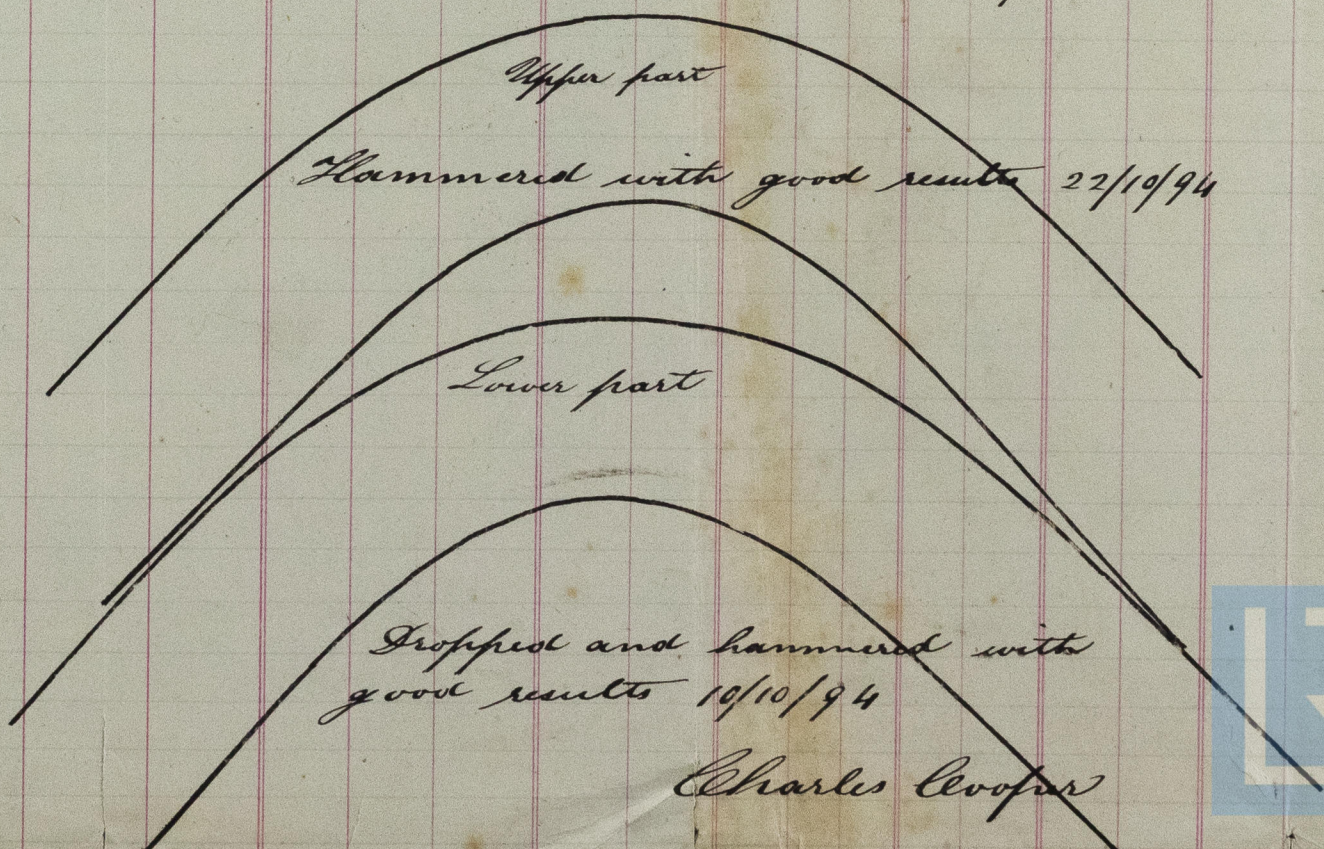

© 2019  
Lloyd's Register  
Foundation

BEL64-0220



© 2019

Lloyd's Register Foundation

BEL 64-0220



94

Stern Frame.

basting

Star of New Zealand

Belfast Rpt. No 4475



© 2019

Lloyd's Register  
Foundation