
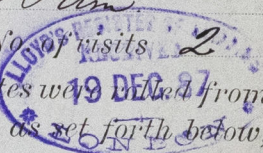


TESTS OF BOILER STEEL.

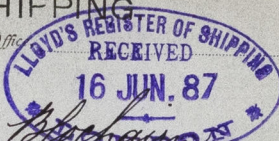

Tests of 9 Steel plate manufactured by The Steel Co. of Scotland of Glasgow
for Boiler No. 283 to be constructed by Messrs Gairney Bros. of Dundee
for the S.S. "Maudslayi" (N^o. 132) Building by the same firm.
Date first visit 14/5- last visit 19/5- No. of visits 2

The _____ specified in the accompanying copy of Advice Notes was _____ from
charges. The tensile test has been applied to 3 samples as set forth below,
and the temper and bending tests Satisfactory

When a second test is applied, the result should be recorded immediately below the record of the original test. The number of plates or bars included in a rejection must be clearly stated.

No.	Purpose.	Charge Mark.	No. of plates or bars in same charge.	Mark on plate and test piece.	Dimensions.			Ultimate Stress.		Exten. in 8 ins.	Remarks.
					Thickn.	Brdth.	Area.	Total.	Sq. Inch		
					Inch.	Inch.	Inch.	Tons.	Tons.	%	
	Centre plate	E.131		8674	.84	1.1	924	26.3	28.4	24	Hanging done by The Steel Co. of Scotland at Blochairn.
	End plate	L.117		8797	.75	1.26	945	27.8	29.4	24.5	
	" "	A.139		8809	.76	1.26	958	27.55	28.6	28	

D.F.
25/6/87

Fee £ : :
Expenses £ : :
£ : :

To be paid by



© 2019
J. C. Roberts
Surveyor, Lloyd's Register
Glasgow
14/6/87

Mepus Goulay Bir.
N. 283 B.



© 2019

Lloyd's Register
Foundation